

Oregon

DEPARTMENT OF
AVIATION

Pavement
Evaluation/
Maintenance
Management Program
2011




Pavement
Consultants Inc.

Burns Municipal
Airport

Oregon Department of Aviation

**2011 Pavement Evaluation / Maintenance
Management Program**

**Final Report – Individual Airports
Functional Category 3**

Prepared for:

State of Oregon
Department of Aviation
3040 25th Street SE
Salem, Oregon 97303-1125

Prepared by:

Pavement Consultants Inc.
7530 Roosevelt Way N.E.
Seattle, Washington 98115-4221

July 2011

Table of Contents

Introduction	1
Pavement Inventory.....	3
Records Review.....	3
Network Definition	3
Branch and Section Names.....	4
Network Identifiers.....	5
Network Identification.....	5
Zone	5
Functional Category.....	5
Funding Group	5
Ownership.....	5
Climatic Region	6
Branch or Section Identifiers	6
Branch Use	6
Pavement Rank.....	6
Surface Type.....	6
Structural and Construction History Data.....	6
Field Verification	7
Inspection Schedule	8
Detailed Inspection	8
Methodology.....	8
Pavement Condition Index Calculation.....	10
Monthly Drive-By Inspection	10
Record Keeping and Data Retrieval	12
Pavement Condition Prediction.....	13
Typical Maintenance Requirements.....	18
Appendix: Your Airport Report	

Table of Contents (continued)

List of Figures

1.	Monthly Drive-By Inspection Form.....	11
2.	Performance Curve for Category 3 AC Runways - Eastern Oregon.....	13
3.	Performance Curve for Category 3 AC Taxiways - Eastern Oregon.....	14
4.	Performance Curve for Category 3 AC Aprons - Eastern Oregon.....	14
5.	Performance Curve for Category 3 AAC Runways - Eastern Oregon.....	15
6.	Performance Curve for Category 3 AAC Taxiways - Eastern Oregon.....	15
7.	Performance Curve for Category 3 AAC Aprons - Eastern Oregon.....	16
8.	Performance Curve for Category 3 PCC Runways -Eastern Oregon.....	16
9.	Performance Curve for Category 3 PCC Aprons - Eastern Oregon.....	17

List of Tables

1.	Pavement Condition Index Distress Types and Related Causes.....	9
2.	Selection of Number of Sample Units to Inspect.....	10
3.	Micro PAVER Reports.....	12
4.	Unit Costs for the Various Work Plan Activities.....	18

Introduction

The Oregon Department of Aviation has been collecting pavement condition information at eligible airports since the mid 1980s. In January 1995 the Federal Aviation Administration (FAA) mandated that any airport sponsor receiving and/or requesting federal funds for pavement improvement projects must have implemented a pavement maintenance management program. Through the Department's system planning efforts, the airports included in the Department's Pavement Evaluation / Maintenance Management Program have been complying with the intent of the law since the mid 1980s, well ahead of the FAA mandate. The information collected during this study ensures that your airport continues to comply with the Federal mandate. The developed pavement maintenance management program, as it relates to an individual airport, is described in this report.

The Oregon Department of Aviation routinely provides information to airport owners and operators throughout the State that assists them in maintaining and operating their airports. The State addresses many issues as part of their planning process, one of which is to provide to each individual airport, on a three-year cycle, a report on pavement condition. Through the statewide study, pavement maintenance management programs for all eligible airports in the state are efficiently and economically completed through the Department of Aviation's Pavement Evaluation / Maintenance Management Program.

Each airport owner or operator makes frequent decisions about the timing and type of maintenance and repair activities that should be completed on their pavements to maintain acceptable surface condition and adequate load-carrying capacity. The pavement maintenance management program described in this document, and supplemented by the information contained in the attached report prepared specifically for your airport, will assist you in making necessary decisions about pavement maintenance and rehabilitation projects at your airport, and will ensure compliance with the Federal mandate.

To develop a pavement maintenance management program for each eligible airport, the Department of Aviation elected to conduct pavement evaluations (visual inspections), and to implement the Micro PAVER pavement maintenance management software. These activities were completed as part of the Department's Continuous Aviation System Plan efforts. Micro PAVER uses the evaluation results to efficiently identify pavements requiring maintenance and rehabilitation, and to establish project priorities. The software can also be used to assess overall pavement network condition, prepare and forecast the budgets required to maintain the network at an acceptable condition level, and identify required maintenance and rehabilitation activities.

The federally mandated pavement maintenance management program identifies five major requirements:

- **Pavement inventory**
- **Inspection schedule (detailed and monthly)**
- **Record keeping**
- **Information retrieval**
- **Program funding**

The approach taken to meet these program requirements for your airport is described in this report.

Pavement Inventory

The FAA-mandated Pavement Inventory requirement specifies that information about each piece of pavement at an airport be compiled. This information is to include, at a minimum: pavement location, pavement dimensions, pavement surface type, and last construction date. The process used to develop this information is discussed under “Records Review”.

Additionally, information is collected about the pavements at an airport so its pavement network can be defined. After the pavement network is defined, pavement inspections can be completed and a pavement maintenance management program can be developed. The methodology for defining the pavement network follows the Records Review discussion.

Records Review

The first step in meeting FAA’s pavement maintenance management program requirement is to develop a maintenance and construction history for all pavements at an airport. For the past 26 years the Oregon Department of Aviation has, for its eligible airports, been conducting pavement evaluations to determine existing condition. In 1991 Pavement Consultants Inc. began assisting the Department in their efforts to compile and update that information. The information collected was used to develop a pavement maintenance management program for each eligible airport as described in this report, and your attached individual airport report.

Previous State-sponsored projects identified pavement layout, pavement construction history and pavement condition at each eligible airport. During this inspection cycle these documents were reviewed, and follow-up inquiries on pavement construction history were directed to the Oregon Department of Aviation, the FAA, consultants and airport sponsors. Based on this review, pavement boundaries were identified at your airport and were placed on an AutoCAD-generated base map (see Figure 1 in your attached airport report). ***The established base map fulfills the FAA "Pavement Inventory" requirement for locating pavements, identifying their dimensions, and identifying pavement type and age.***

Network Definition

Once the pavement history at an airport has been compiled, individual pavement features can be identified, a process called network definition. These pavement features are defined on the basis of: primary use, construction history, and traffic pattern. Each airport is divided into features according to the guidelines contained in the current edition of ASTM International-Standard D5340, *Standard Test Method for Airport Condition Index Surveys*. The pavement features used in this project are defined as follows.

Network: Each eligible airport constitutes a separate pavement network.

Branch: A branch is any identifiable part of a pavement network that has a distinct function. Airfield pavements such as individual runways, taxiways and aprons are each considered to be a separate branch.

Section: A section is a subdivision of a branch and has consistent characteristics throughout its length or area. These characteristics include: pavement layer material type and thickness, construction history, traffic, and pavement condition. A section is the basic management unit of a pavement network, and is that portion of a branch over which a maintenance and rehabilitation project is likely to be completed.

Sample Unit: A sample unit is an arbitrarily defined portion of a pavement section that is used when performing detailed pavement inspections. It is the smallest subdivision in a pavement network. For flexible airport pavements such as asphalt concrete or surface treatment, sample units are about 5,000 square feet in area. For rigid (portland cement concrete) airport pavements, sample units typically include approximately 20 contiguous pavement slabs.

Beginning 26 years ago, branches, sections and sample units were established for each eligible airport in the Oregon system. During this project, these divisions were reviewed and modified as required, based on changed conditions (new pavements, demolished pavements), or completion of any pavement-related maintenance and rehabilitation projects.

Branch and Section Names

Each pavement feature is assigned a name that allows it to be uniquely identified in the statewide airport system. Each branch name consists of a series of characters. The first character indicates the branch type: “R” for Runway, “T” for Taxiway, “A” for Apron and “H” for Helipad. The last two characters in the branch name identify the airport to which the branch belongs and were taken from the airport name. All branches for your airport carry this airport-specific two-letter identifier. The individual runway, taxiway or apron referenced is identified by characters located between the branch type (“R”, “T”, “A” or “H”) and your two-letter airport identifier. To the extent possible, these identifying characters were chosen to reflect the facility names you use. If the facility does not have a name it was assigned a number. In the case of runways, numbers are used that are the lower of the two runway numbers corresponding to compass bearing.

Located after a hyphen following the branch name are two- or three alpha-numeric characters. These characters identify the section within the branch. An example illustrating the naming convention is:

R16AB-01

which is the name for Runway 16/34, Albany Municipal Airport, Section 01.

The branches, sections and sample units identified for your airport are shown on Figure 2 in your attached individual airport report.

Network Identifiers

Several designators are used to describe information about a particular airport included in the State System Plan. These designators include: network identification, zone, functional category, funding group, ownership and climatic region.

Network Identification

Each airport in the statewide system is assigned a unique network identifier (name). This name is typically the name of the city in which the airport is located. The network identification name for your airport can be found in the appendices attached to your airport report. This network identification name is assigned so that an individual airport or a group of airports contained in the statewide database can be selected for evaluation. The statewide database contains information for all eligible airports in the State.

Zone

Zones are used to allow individual airports within the statewide database to be separately selected for analysis. The FAA airport designator was used as the zone designator.

Functional Category

Each airport is assigned a functional category based on its classification within the State System Plan. Each airport was assigned a functional category of either 1, 2, 3, 4 or 5 in accordance with the criteria set forth in the System Plan. These categories correspond to the following airport types: commercial service, business or high activity general aviation, regional general aviation, community general aviation, and low activity general aviation. The category assigned to your airport is listed in the appendices attached to your airport report. This category assignment allows groups of airports in different functional categories to be separately evaluated.

Funding Group

Airports in the State were categorized as either NPIAS or non-NPIAS. NPIAS designated airports are eligible for project funding under the FAA's Airport Improvement Program (AIP). Being designated as NPIAS or non-NPIAS in the database allows the Department to evaluate funding alternatives for the State airport system.

Ownership

Airport ownership is designated as Public, State or Private. This designation allows the Department to evaluate funding allocations based on eligibility for State and/or Federal funding.

Climatic Region

Each airport in the statewide system was assigned to one of the three climatic regions - eastern, central or coastal. Because climatic conditions can impact pavement performances, assigning airports to a climatic region allows pavement performance to be more accurately modeled resulting in more accurate pavement condition forecasts.

Branch or Section Identifiers

Several designators are used to describe a branch or section's function, importance or construction. These characteristics are: branch use, pavement rank, and surface type.

Branch Use

Branch use identifies the primary use of each distinct pavement area. For each airport pavement included in this study, a branch use of "Runway", "Taxiway", "Apron" or "Helipad" is assigned, as appropriate.

Pavement Rank

Pavement rank refers to the relative importance assigned to multiple facilities having the same branch use. Each pavement section is assigned a rank of primary ("P"), secondary ("S") or tertiary ("T") as appropriate. As an example, an airport with two runways might rank the more heavily used runway as primary and the lesser-used runway as secondary. The pavement rank assigned to each pavement section at your airport can be found in the appendices attached to your individual airport report.

Surface Type

Each pavement section is assigned a surface type designator based on the type of surface material present. Throughout the State seven surface types were encountered: asphalt overlay over asphalt concrete (AAC), asphalt concrete (AC), asphalt concrete over cement treated base (ACT), asphalt overlay over portland cement concrete (APC), asphalt concrete over pozzolanic base (APZ), portland cement concrete (PCC), and surface treatment (ST). The surface type assigned to each pavement at your airport is provided in the report appended to this document. ***Surface type identification fulfills one of FAA's "Pavement Inventory" requirements.***

Structural and Construction History Data

Available construction records for each airport were obtained from the Oregon Department of Aviation, Federal Aviation Administration, or consultants. These records were reviewed to establish a last construction date for each pavement section. Additional information was requested from individual airport sponsors to update or clarify this information, as necessary. The last construction date and known construction history for each pavement section can be found on Figure 1 in your individual airport report. The last construction date is also identified in the reports found in the attached appendixes. For those pavement sections where information was not

available, a last construction date was assigned based on pavement condition. ***Last construction date identification fulfills the final FAA "Pavement Inventory" requirement.***

Field Verification

Information obtained through the records review and discussions with airport sponsors, Department of Aviation staff, FAA personnel and consultant staff was field-verified to ensure that each facility is accurately mapped and properly subdivided into branches and sections. Modifications to the maps, and/or branch and section divisions, were made as necessary wherever discrepancies in airport geometry, paving materials, or construction history were found during the visual inspections.

Inspection Schedule

The FAA's Pavement Maintenance Management Program guidelines require all airports seeking or receiving federal funds for pavement-related projects to complete both detailed and drive-by inspections. The guidelines require that detailed inspections be performed yearly, unless the inspections are conducted in accordance with the Pavement Condition Index methodology set forth in ASTM D5340, at which point detailed inspections are required once every three years. ***The Pavement Condition Index inspections for Oregon's airports are conducted on a three-year cycle thus complying with the FAA detailed inspection requirement.***

The drive-by inspections required by the FAA are to be completed monthly. These inspections are cursory inspections that are performed to detect any unexpected changes in pavement condition.

A description of the detailed inspection methodology, as well as an approach to completing the monthly drive-by inspections, is provided.

Detailed Inspection

Methodology

Pavement condition index (PCI) surveys were performed in the 2011 for all airports included in this year's project. The surveys were performed using the Pavement Condition Index (PCI) methodology developed by the U.S. Army Corps of Engineers, and outlined in the current edition of ASTM D-5340, *Standard Test Method for Airport Condition Index Surveys*. This document defines distress types, severity levels, and methods for measuring and recording distresses.

The PCI procedure was developed to collect data that would provide engineers and managers with a numerical value indicating overall pavement condition, and that would reflect both pavement structural integrity and operational surface condition. The procedure was designed to be highly repeatable and was found to be well-correlated with the judgment of experienced pavement engineers.

A PCI survey is performed by measuring the amount and severity of certain defined distresses (defects) observed in a sample unit. Table 1 lists both the asphalt concrete and portland cement concrete pavement distress types considered in the PCI method, and also identifies their most common cause (load, climate/durability, other). Load-related distresses are apparent where the pavement has been over-stressed by traffic loads applied to its surface. Climate/durability-related distresses arise due to exposure to the environment. Other-related distresses are caused by actions not related to load or climate such as fuel spills or construction deficiencies.

Table 1. Pavement Condition Index Distress Types and Related Causes.

Asphalt Concrete		Portland Cement Concrete	
Pavement Distress	Related Cause	Pavement Distress	Related Cause
Alligator Cracking	Load	Blow-Up	Climate/Durability
Bleeding	Other	Corner Break	Load
Block Cracking	Climate/Durability	Cracks: Longitudinal, Transverse, and Diagonal	Load
Corrugation	Other / Load	Durability ("D") Crack	Climate/Durability
Depression	Other / Load	Joint Seal Damage	Climate/Durability
Jet Blast Erosion	Other	Patching, Small	Other
Joint Reflection Cracking	Climate/Durability	Patching, Large and Utility Cuts	Other
Longitudinal and Transverse Cracking	Climate/Durability	Popouts	Other / Climate/Durability
Oil Spillage	Other	Pumping	Load
Patching and Utility Cut Patching	Other	Scaling, Map Cracking, Crazeing	Other
Polished Aggregate	Other	Settlement or Faulting	Load
Raveling	Climate/Durability	Shattered Slab / Intersecting Cracks	Load
Rutting	Load	Shrinkage Cracks	Other
Shoving	Other	Spalling (Longitudinal and Transverse Joint)	Other / Load
Slippage Cracking	Other / Load	Spalling (Corner)	Other / Load
Swell	Other	Alkali Silica Reaction (ASR)	Other
Weathering	Climate/Durability		

To obtain a statistically reliable PCI for a given pavement section it is not necessary to inspect all sample units in that section. A pre-determined number of randomly chosen sample units are selected for inspection based on the total number of sample units in the section. The sampling rates used during this study are shown in Table 2. The sampling rates contained in Table 2 result in data that are reliable at a 92 percent confidence level.

Table 2. Selection of Number of Sample Units to Inspect.

Flexible Pavement		Rigid Pavement	
N	n	N	n
1	1	1	1
2 - 3	2	2	2
4 - 6	3	3 - 4	3
7 - 13	4	5 - 6	4
14 - 38	5	7 - 8	5
39 +	6	9 - 11	6
		12 - 14	7
		15 - 19	8
		20 - 27	9
		28 - 38	10
		39 - 58	11
		59 - 104	12
		105 - 313	13
		314 +	14

Where: N = Total number of sample units in a pavement section
n = Number of sample units to be surveyed

Pavement Condition Index Calculation

To calculate a PCI for a given sample unit, each distress type observed is assigned a deduct value based on its density (frequency of occurrence) within that sample area, and its severity. All deducts are summed and subsequently adjusted (corrected) for the number of different distresses found. This corrected deduct value is subtracted from 100, the PCI for a "perfect" pavement, to arrive at a PCI for that particular sample unit. The PCI for a pavement section is the area-weighted average PCI value of all sample units evaluated in that section. Pavement Condition Ratings (PCRs) are associated with ranges of PCI values.

The color-coded Figure 3 in your attached individual airport report shows the PCRs and their associated PCI ranges, as well as the pavement condition at your airport in May/June 2011.

Monthly Drive-By Inspection

As part of the FAA-mandated pavement maintenance management program, a monthly drive-by inspection is required. This inspection is intended to identify abrupt changes in condition occurring since the last monthly inspection, and to record any maintenance activities completed during the previous month. This inspection can easily be accomplished by driving your airport and noting any changes or maintenance performed on the form provided in Figure 1. Each drive-by inspection must note the date the inspection was completed, and record any maintenance performed since the last inspection. These records must be kept on-file for five years.

Record Keeping and Data Retrieval

The FAA pavement maintenance management program requires that compiled records be kept for five years. To facilitate record keeping and data retrieval at the State level, the Micro PAVER pavement maintenance management software was implemented. Micro PAVER provides the Oregon Department of Aviation with a method for storing data and generating reports.

Micro PAVER was developed by the U.S. Army Construction Engineering Research Laboratory (USA-CERL). The program uses the guidelines contained in the current edition of ASTM D5340 as its basis. The current version, Version 6.5.1, is a Windows-based program that can store pavement condition information, as well as construction and maintenance history information. Using the data stored in the Micro PAVER database the user has many capabilities, including: evaluating current condition, predicting future condition, determining maintenance and rehabilitation needs, scheduling future inspections, and preparing budget estimates.

The statewide database containing the information for all evaluated airports was updated during this project. Information for each individual airport can easily be extracted from the statewide database. The database allows required records to be stored indefinitely, thus meeting the FAA requirement that records be maintained for a five-year period. Additionally, the software allows data to be retrieved quickly and efficiently.

After data were entered for each airport into the State's Micro PAVER database, the software was used to analyze the stored data and to generate useful reports. The reports described in Table 3 were generated for your airport and are provided as appendices to your individual airport report.

Table 3. Micro PAVER Reports.

Report Name	Report Description
Branch Condition	Lists information about each branch, including: network identification, branch identification, name, use, number of sections, total branch area and the average and area-weighted average PCI for the entire branch.
Section Condition	Provides information about each section, including: branch identification and section number, last construction date, surface type, use, rank, section area, last inspection date, age of pavement at last inspection and the PCI at the last inspection.
Network Maintenance	Applies the stored distress maintenance policy to the pavement network and identifies the type and cost of routine maintenance required across the entire network. Information in this report is listed by section.
Re-Inspection	Summarizes the distress data collected during the most recent inspection and provides the PCI for each sample unit inspected, as well as summary information about the section.

Pavement Condition Prediction

To allow future pavement condition to be predicted, data collected throughout the State were used to generate "performance curves". The curves were developed based on surface type, use, airport functional category and climatic region. These curves (models) are used to predict future pavement condition by assuming the behavior of an individual pavement section is similar to the behavior of the pavement sections used to generate the "performance curve". Figures 2 through 9 show the "performance curves" used to model pavements in your airport's functional category and climatic region.

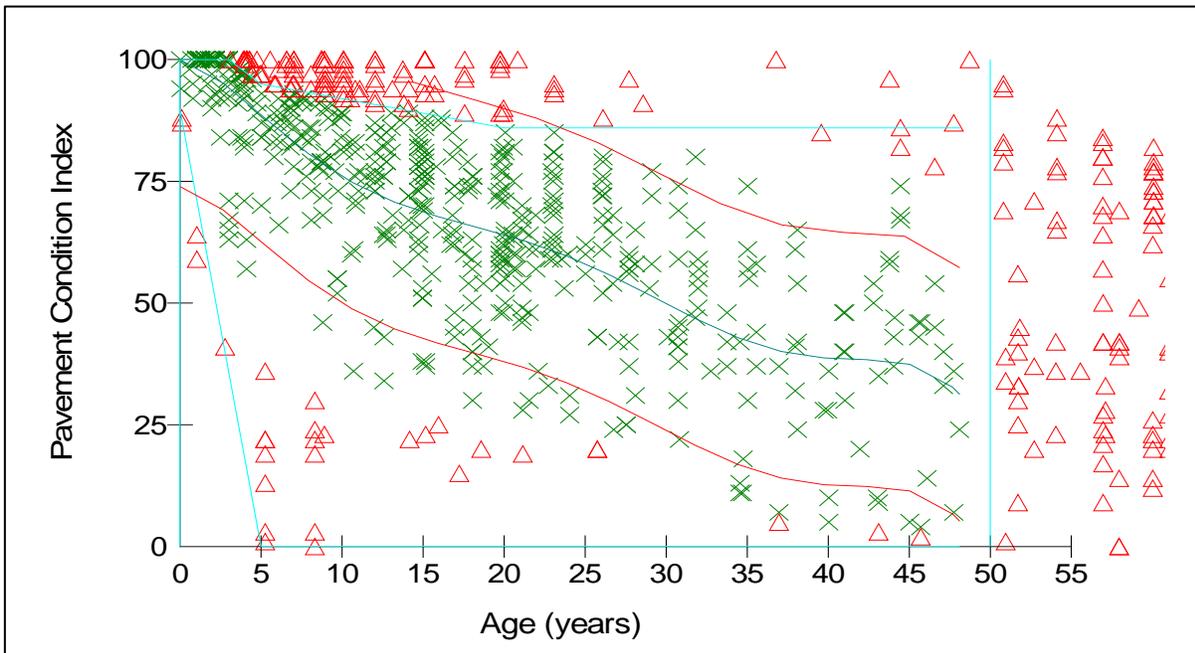


Figure 2. Performance Curve for Category 3 AC Runways - Eastern Oregon.

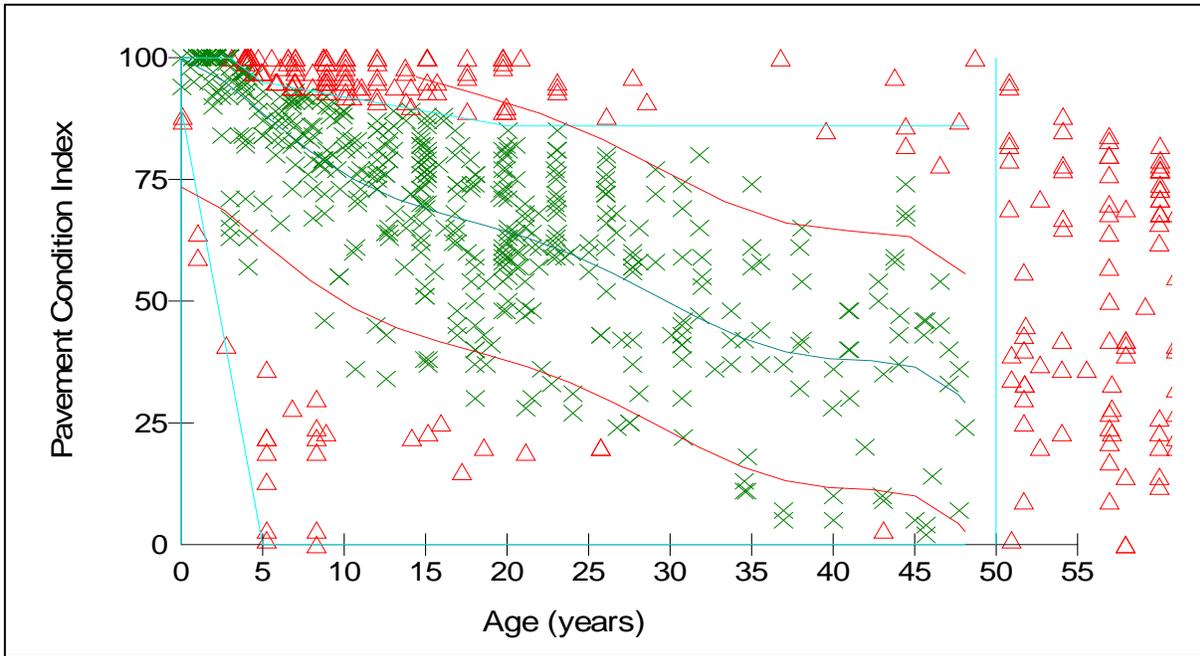


Figure 3. Performance Curve for Category 3 AC Taxiways - Eastern Oregon.

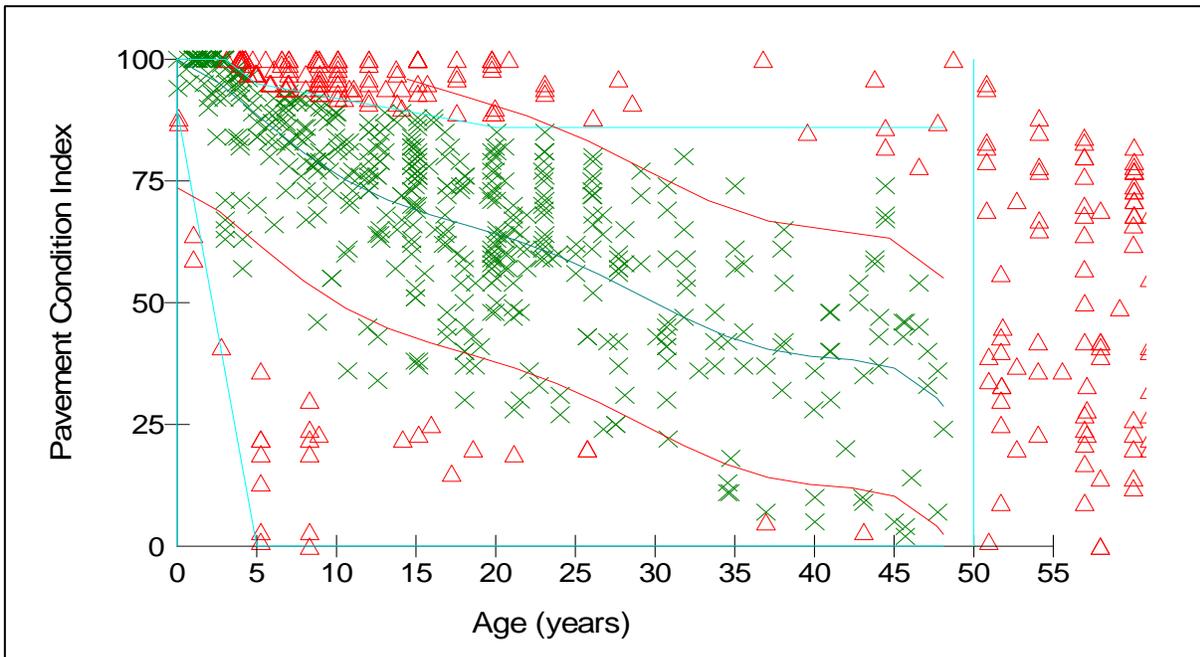


Figure 4. Performance Curve for Category 3 AC Aprons - Eastern Oregon.

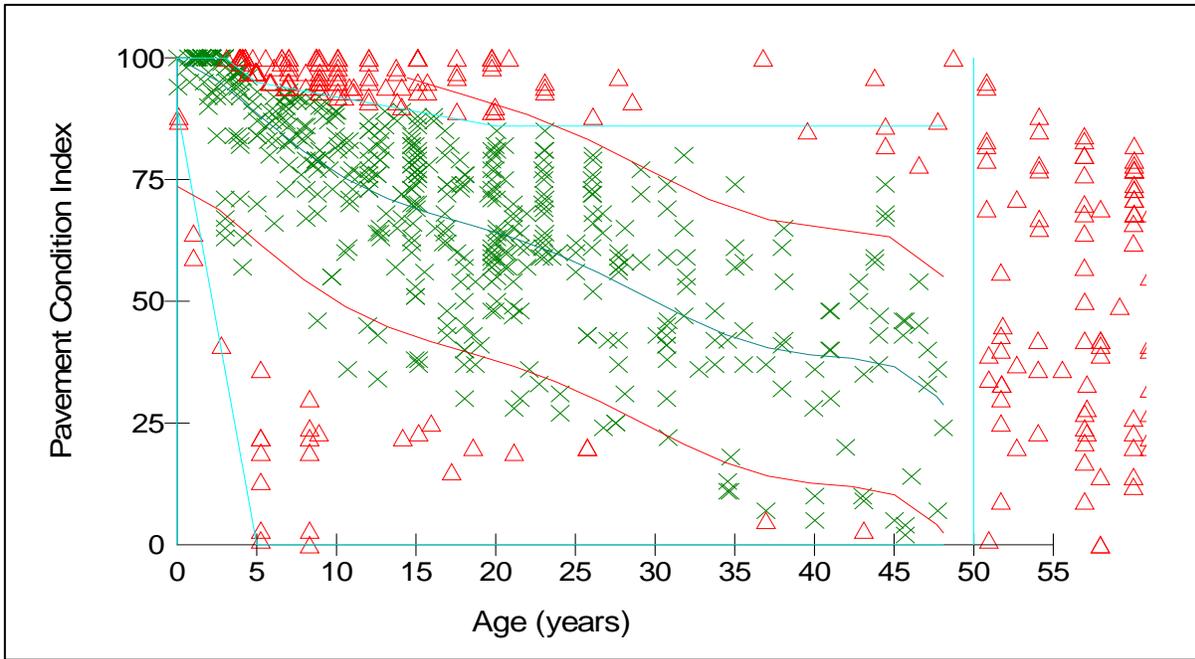


Figure 5. Performance Curve for Category 3 AAC Runways - eastern Oregon.

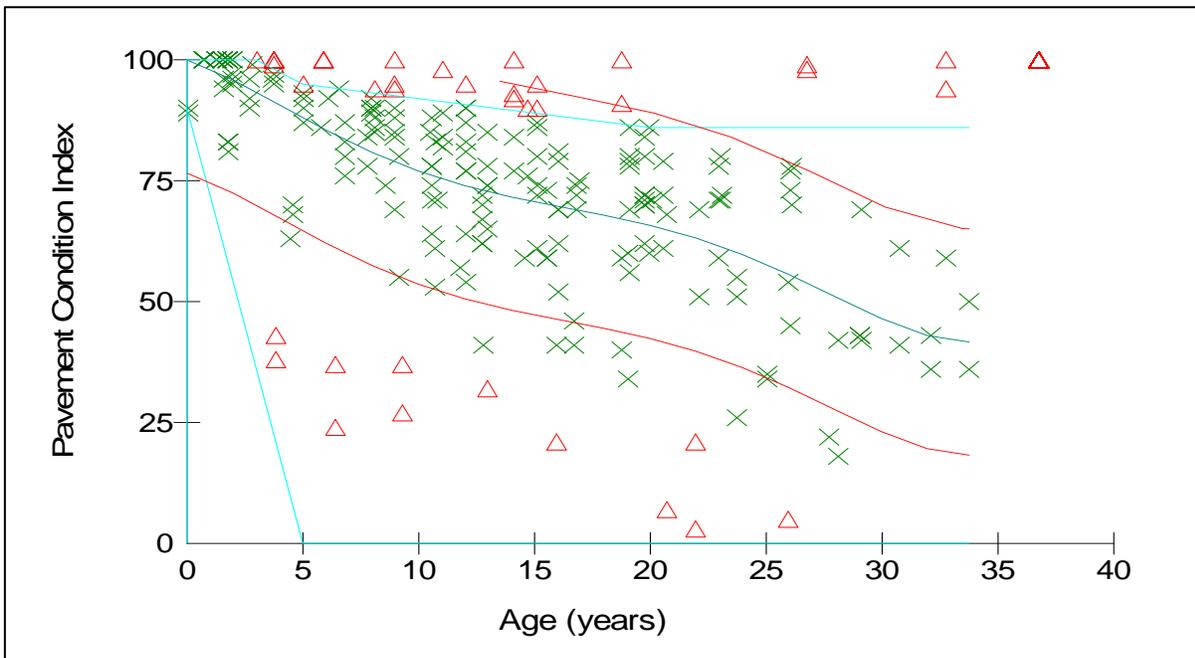


Figure 6. Performance Curve for Category 3 AAC Taxiways - Eastern Oregon.

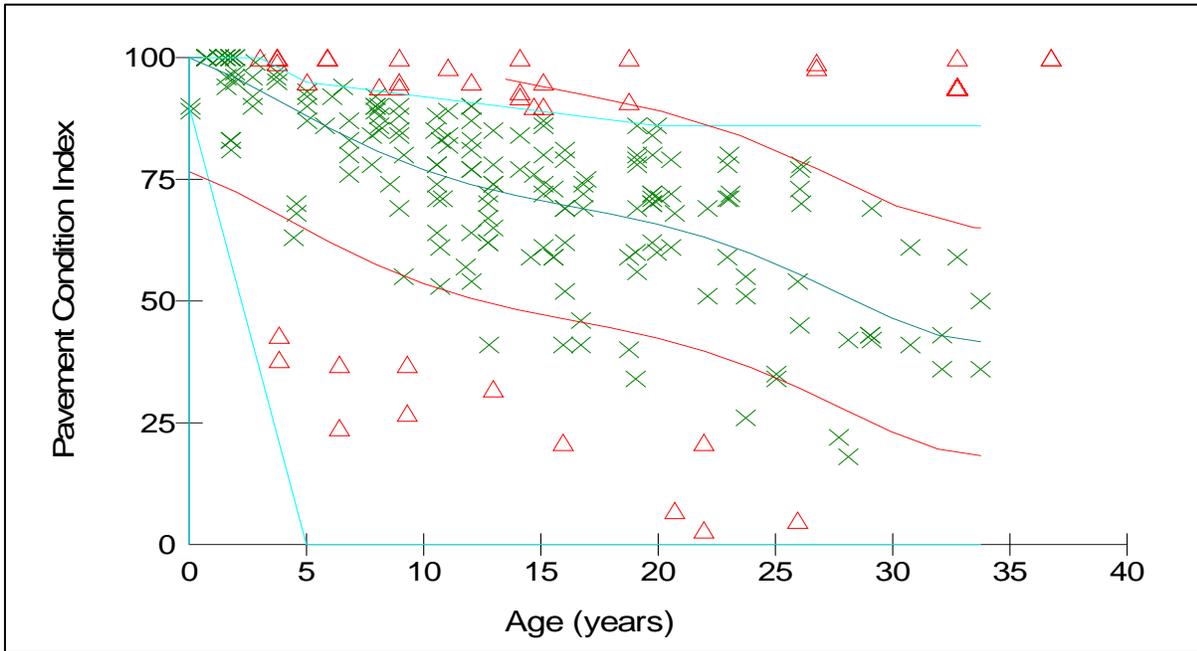


Figure 7. Performance Curve for Category 3 AAC Aprons - Eastern Oregon.

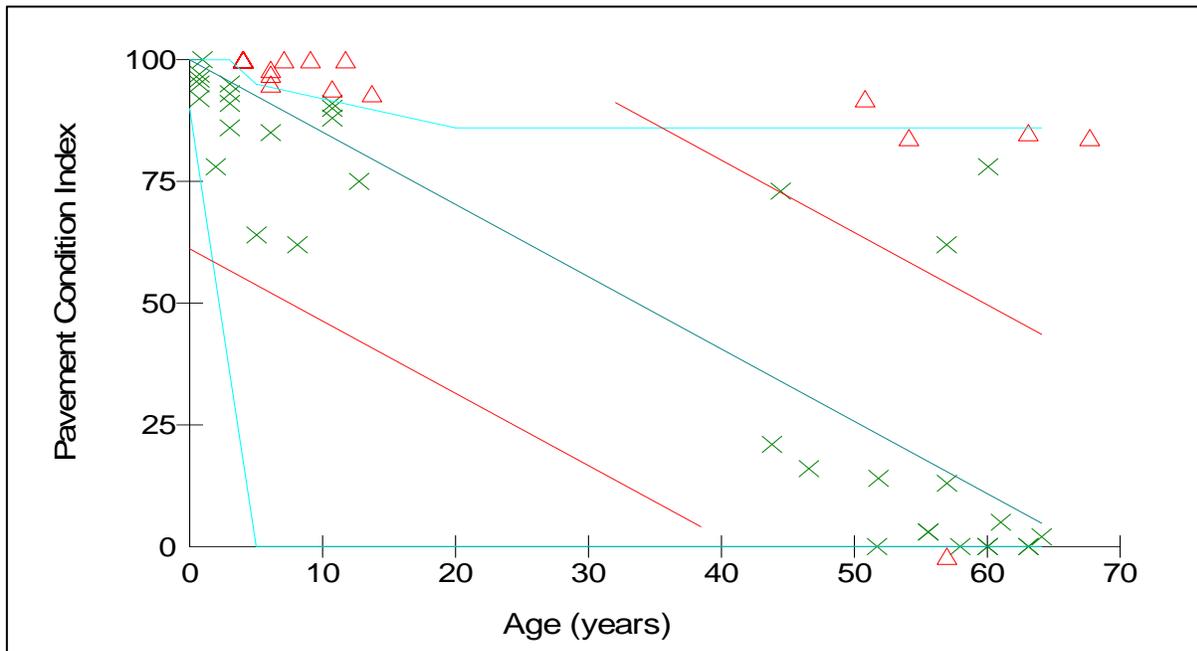


Figure 8. Performance Curve for Category 3 PCC Runways - Eastern Oregon.

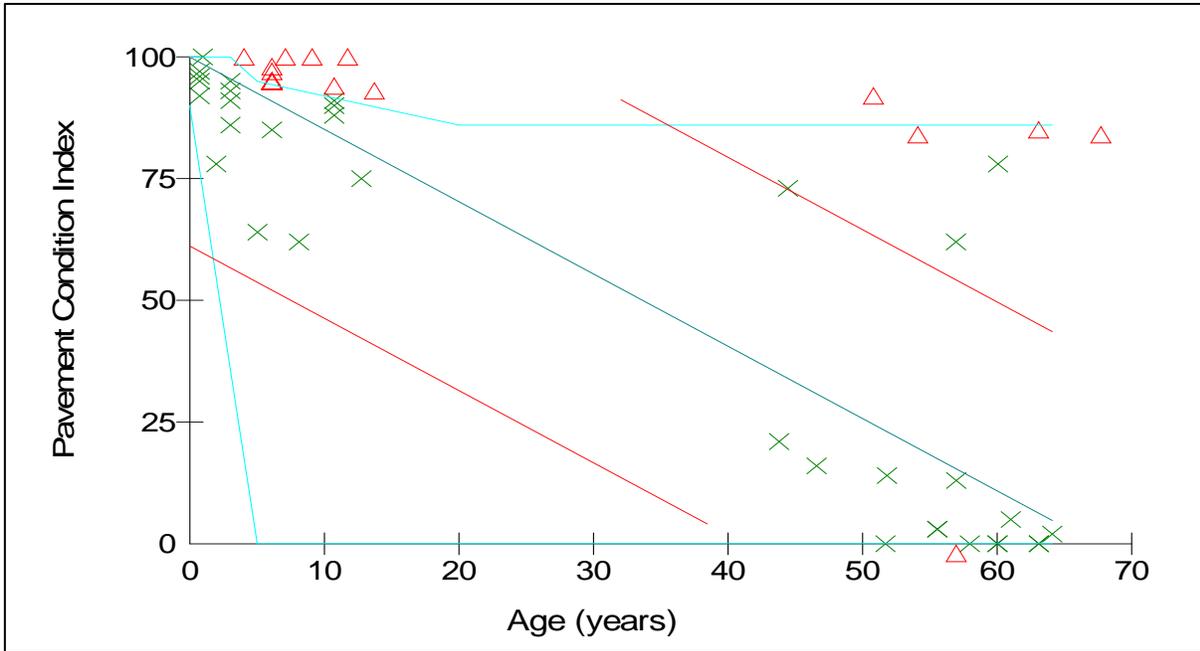


Figure 9. Performance Curve for Category 3 PCC Aprons - Eastern Oregon.

Typical Maintenance Requirements

The Micro PAVER-generated M&R Plan Report was used to identify when pavement maintenance and rehabilitation projects are required for a given pavement section, and what repair type is most appropriate. The repair strategies evaluated were:

- Reconstruction (pavements with Pavement Condition Indices less than 40).
- Overlay flexible pavements (runways with Pavement Condition Indices between 40 and 55, taxiways between 40 and 50, aprons between 40 and 45, and pavements exhibiting significant load-related distress with PCIs above the critical PCI).
- Global maintenance (fog seal, slurry seal or thin (2 inch) overlay) applied on a user-specified interval (6 years for a fog seal, 6 years for a slurry seal, and 10 years for an overlay). The global maintenance type recommended is based on the distress types observed in the section during the visual inspections.
- Routine maintenance, such as crack sealing and patching.

The M&R Plan Report was generated for a 5-year period beginning in June 2012. Included in the work plan are estimated costs for each recommended project. The costs are estimated by applying a unit cost for the recommended activity to the square foot area of the pavement section. The unit costs include adjustments for engineering and administration, mobilization, restriping and contingency. The unit costs used to develop the work plan activity cost are shown in Table 4. The recommended work plan for your airport is provided in your attached individual airport report.

Table 4. Unit Costs for the Various Work Plan Activities.

Activity	Unit	Unit Cost
Fog Seal	SF	\$0.12
Slurry Seal	SF	\$0.23
2" Asphalt Concrete Overlay	SF	\$1.00
2" AC Mill and Replace	SF	\$1.50
Reconstruction	SF	\$3.91 - \$6.66
Reseal PCC Joints w/ Hot Pour Sealant	LF	\$2.00

Your Airport Report

BURNS MUNICIPAL AIRPORT

This report describes how your Pavement Maintenance Management Program (PMMP) was developed. Your Program was developed as part of the Oregon Continuous Aviation System Plan sponsored in part by the Oregon Department of Aviation and the Federal Aviation Administration (FAA). The information and data contained in this report ensures you are in compliance with the requirements of FAA Grant Assurance Number 11 which states that any airport requesting federal funds for pavement improvement projects must have implemented a pavement maintenance management program.

DATA COLLECTION




To determine how your pavements were constructed and their age, a records review was conducted. Figure BU-1 shows the records review results. This figure identifies pavement boundaries, dimensions, pavement layer types, thicknesses and dates of construction. The most recent construction date for each pavement can also be found in the Section Condition Report in Appendix 2. Figure BU-1 and the information contained in Appendices 1, 2 and 4 ensure that your airport complies with the “pavement inventory” requirement of FAA’s PMMP guidelines.

The pavements at your airport were divided into branches, sections and sample units in accordance with the methodology outlined in the current edition of ASTM D5430, *Standard Test Method for Airport Condition Index Surveys*. The branches, sections and sample units established at your airport are shown in Figure BU-2. A Branch Condition Report showing all branches, their associated areas, and their area-weighted average condition is provided in Appendix 1. Additionally, the Appendix 2 Section Condition Report provides information used to define each branch and section in the Micro PAVER database.

Using the branch, section and sample unit divisions established, a visual condition survey was conducted at Burns Municipal Airport on May 27, 2011. During the inspection, pavement defects were identified and measured in accordance with the methodology outlined in ASTM D5430. This inspection ensures your airport complies with the “detailed inspection” requirement of FAA’s PMMP guidelines. After collection, the data were entered into the Micro PAVER software for analysis. These data are reproduced in the Re-Inspection Report attached as Appendix 4.


The Micro PAVER database updated during this project ensures your airport complies with the “record keeping and information retrieval” requirements of FAA’s PMMP guidelines.

Figure BU-1. Airport Layout, Dimensions and Pavement Cross-Sections.

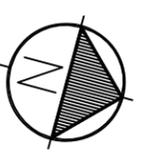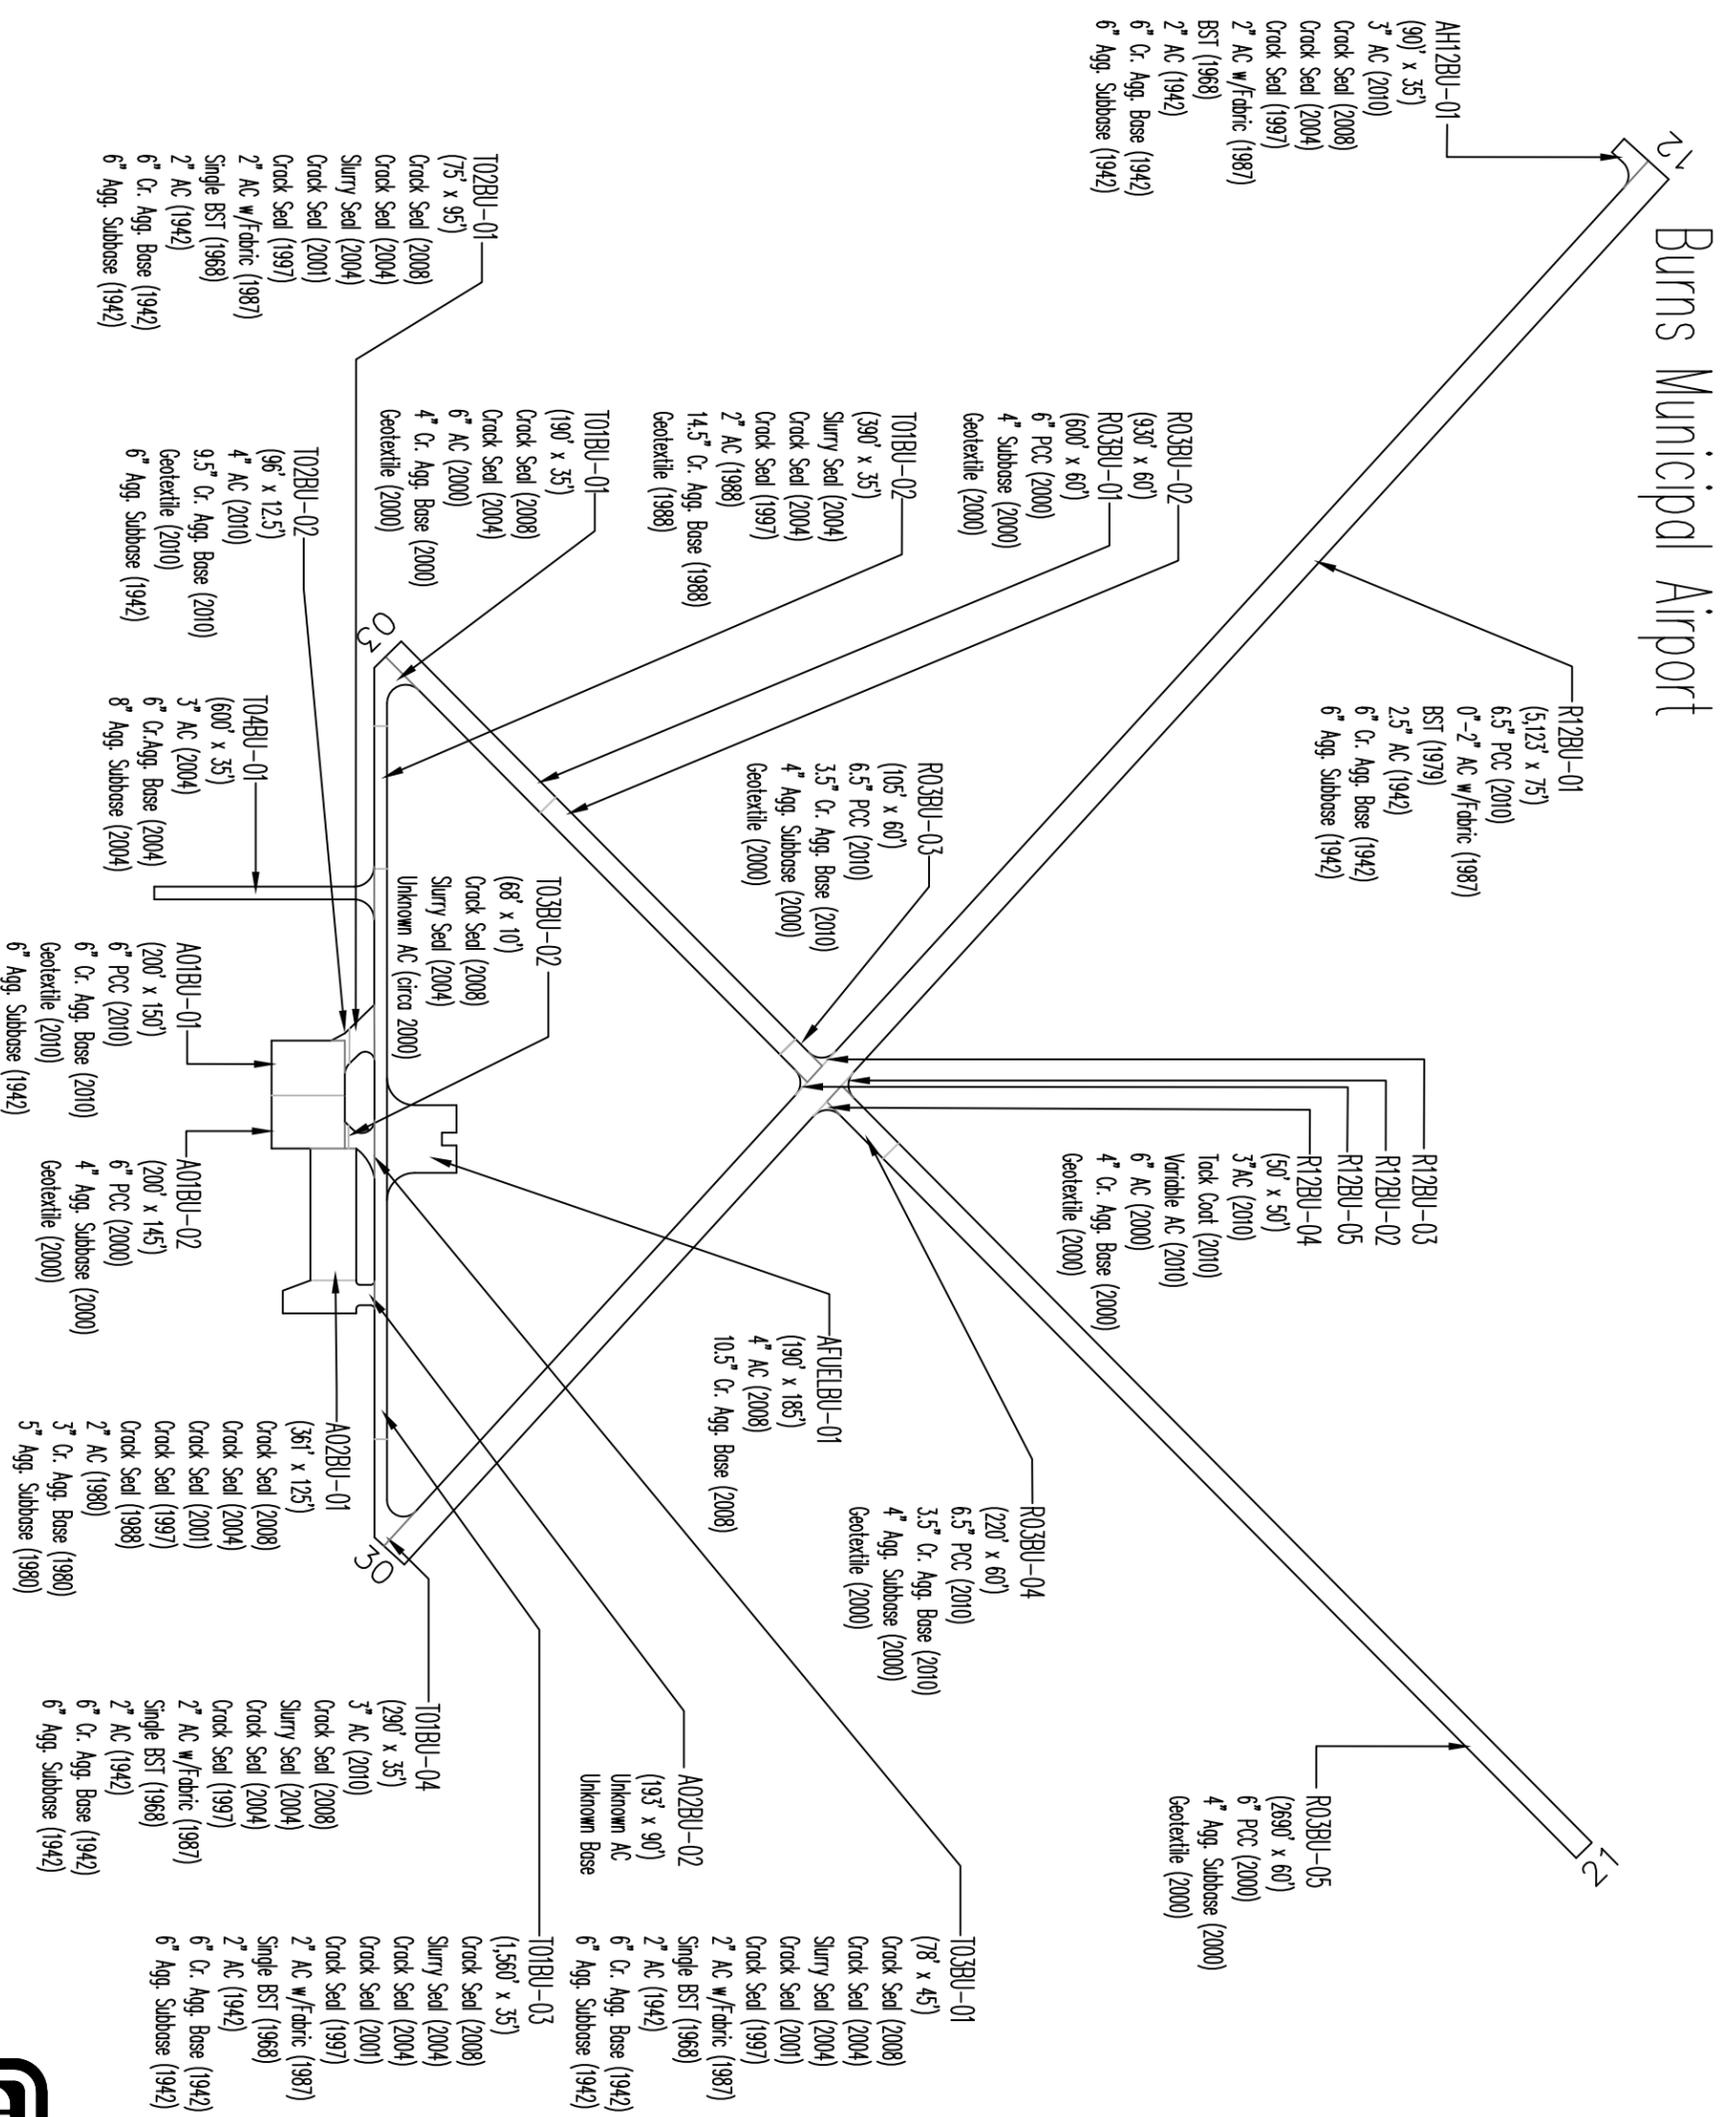

Drawing Date: June 2011

Figure BU-2. Pavement Branch, Section and Sample Unit Layout.
Burns Municipal Airport

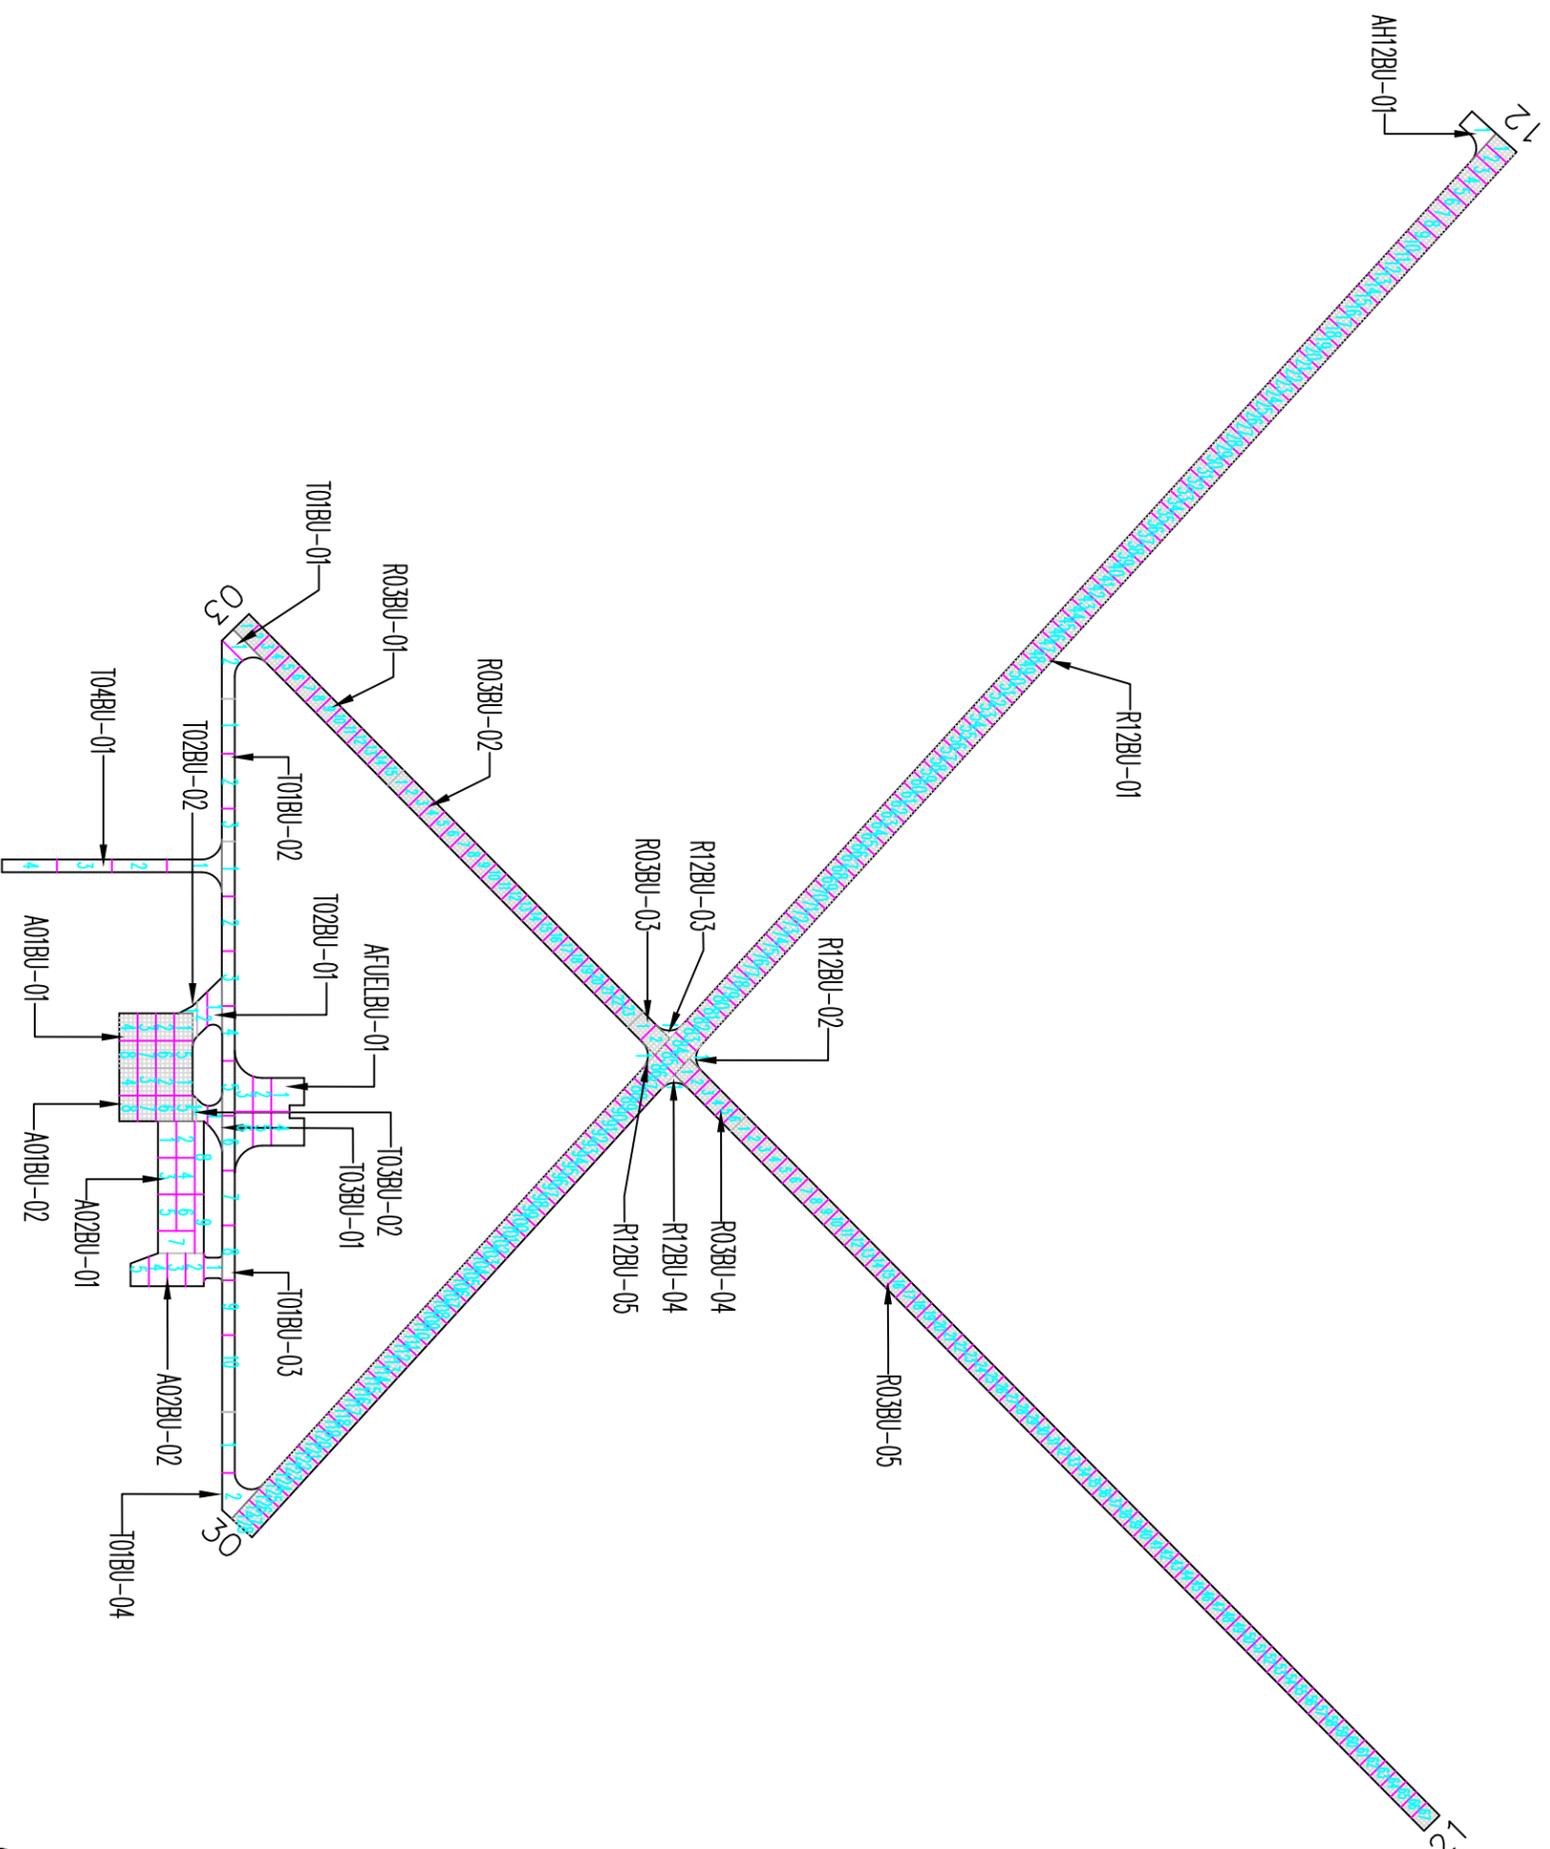

Drawing Date: June 2011



PAVEMENT CONSULTANTS INC.

RESULTS

Using the data collected during the visual inspection, the Micro PAVER software was used to calculate an area-weighted average Pavement Condition Index (PCI) for each pavement section inspected using the sample units evaluated. Using each section's PCI, a Pavement Condition Rating (PCR) was assigned. The PCIs measured during this inspection are shown in Table 1. The table also contains PCIs from past inspections as well as projected PCIs for 2016 and 2021. The projections were based on pavement deterioration models developed by Micro PAVER using the inspection data from other pavements in the same airport category as your airport, located in the same climatic region, and with the same surface type and use.

The ASTM Standard which governs the methodology for conducting the visual inspections was modified in 2010 and could result in changes to the Pavement Condition Index for the current inspection relative to that from the previous inspections. So a slight increase in the PCI value over the PCI values from previous inspections is possible, even if no work has been completed on the pavement.

The Branch Condition Report in Appendix 1 summarizes current pavement condition by branch while the Section Condition Report in Appendix 2 lists pavement condition by section. The current PCR is shown graphically in Figure BU-3.

Table 1. Past, Present and Future Pavement Condition Indices.

Branch	Section	Inspections			Forecast	
		2003	2006	2011	2016	2021
A01BU	01	5	2	92	85	77
A01BU	02	86	92	88	81	73
A02BU	01	60	75	30	17	4
A02BU	02	-	100	87	75	68
AFUELBU	01	-	-	100	89	76
AH12BU	01	69	78	100	88	77
R03BU	01	91	95	90	83	75
R03BU	02	93	97	91	84	76
R03BU	03	-	-	95	88	80
R03BU	04	-	-	97	90	82
R03BU	05	95	97	94	87	79
R12BU	01	81	80	96	89	81
R12BU	02	67	100	100	88	77
R12BU	03	71	100	100	88	77
R12BU	04	63	100	100	88	77
R12BU	05	65	100	100	88	77
T01BU	01	98	98	61	54	45
T01BU	02	69	76	33	19	6
T01BU	03	79	86	55	44	39

Table 1. Past, Present and Future Pavement Condition Indices.

Branch	Section	Inspections			Forecast	
		2003	2006	2011	2016	2021
T01BU	04	52	56	100	88	77
T02BU	01	69	79	51	42	37
T02BU	02	-	-	100	89	76
T03BU	01	62	79	26	21	15
T03BU	02	100	92	83	74	69
T04BU	01	-	100	82	72	67

Section PCIs at Burns Municipal Airport range from a low of 26 (a PCR of “Very Poor”) to a high of 100 (a PCR of “Good”). The area-weighted average PCI for all airport pavements is 87, corresponding to an overall PCR of “Good”. Figure BU-4 shows how much pavement area is associated with each Pavement Condition Rating category and also shows pavement condition distribution from the inspections conducted in 2003 and 2006.

The primary distresses observed during the inspection of asphalt concrete pavements were: raveling, weathering, block cracking, longitudinal and transverse cracking, and alligator cracking with isolated occurrences of patching and depressions. The primary distresses observed during the inspection of portland cement concrete pavements were: joint seal damage, joint spalls, small patches, corner spalls, shrinkage cracks, and large patches with isolated occurrences of scaling, linear cracks and corner breaks.

A graphical representation of the projected PCIs listed in Table 1 is shown in Figure BU-5.

Figure BU-3. Pavement Condition in May 2011.
Burns Municipal Airport









Figure BU-4. Distribution of Pavement Condition Burns Municipal Airport

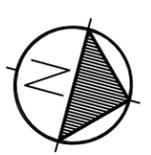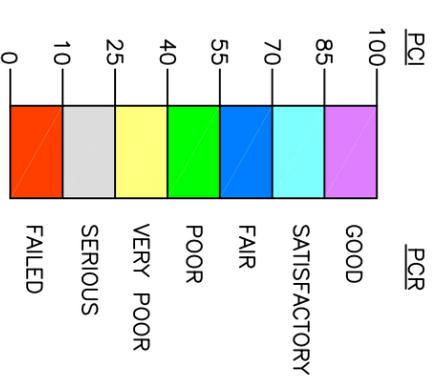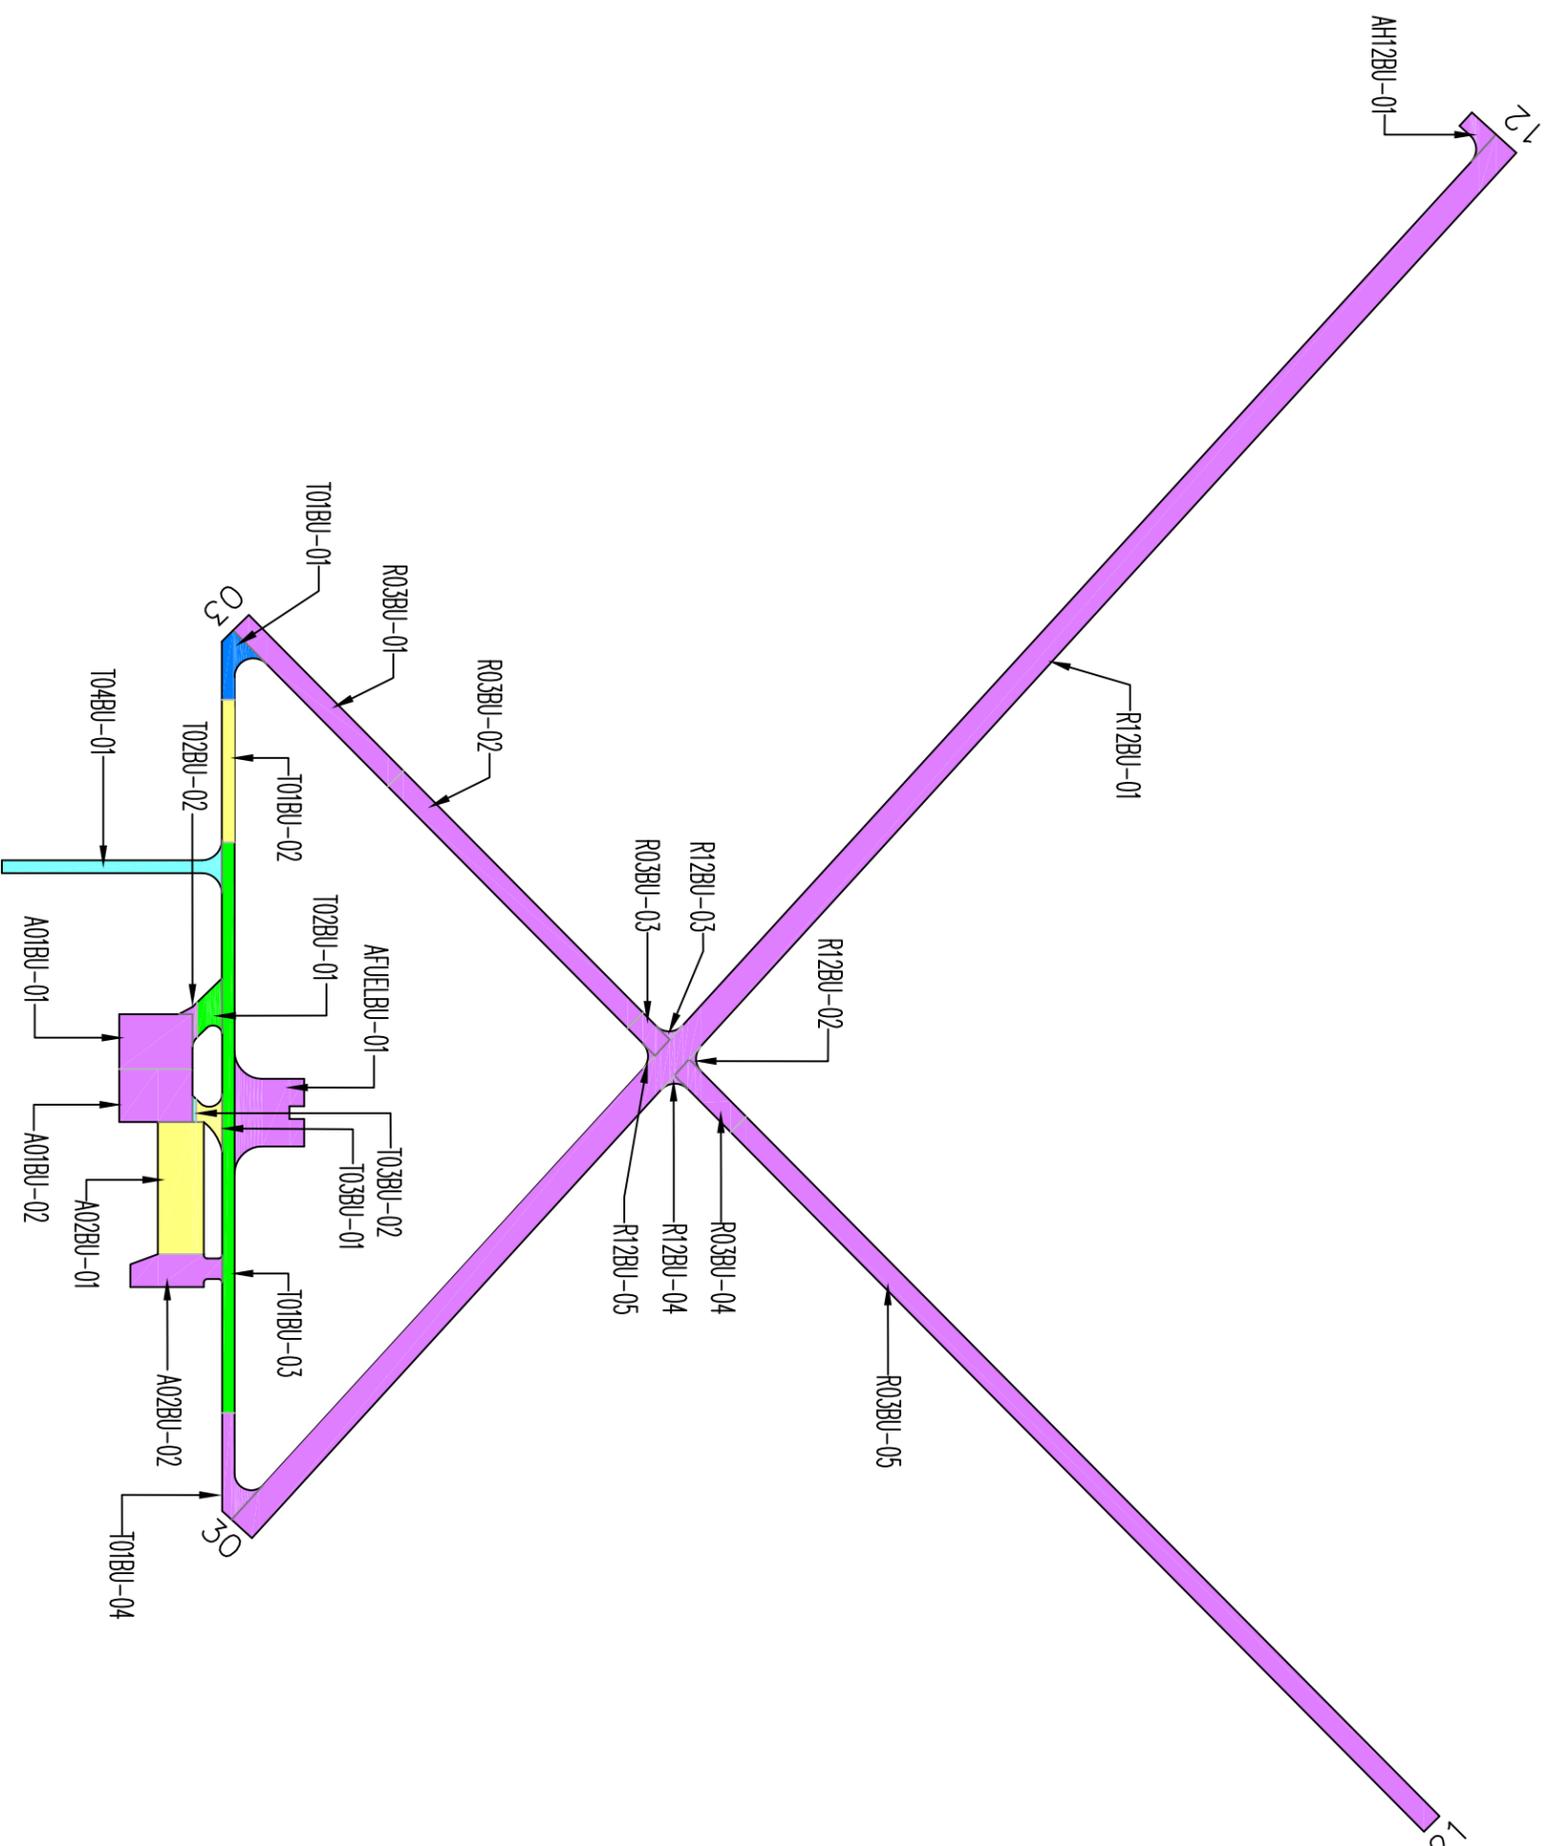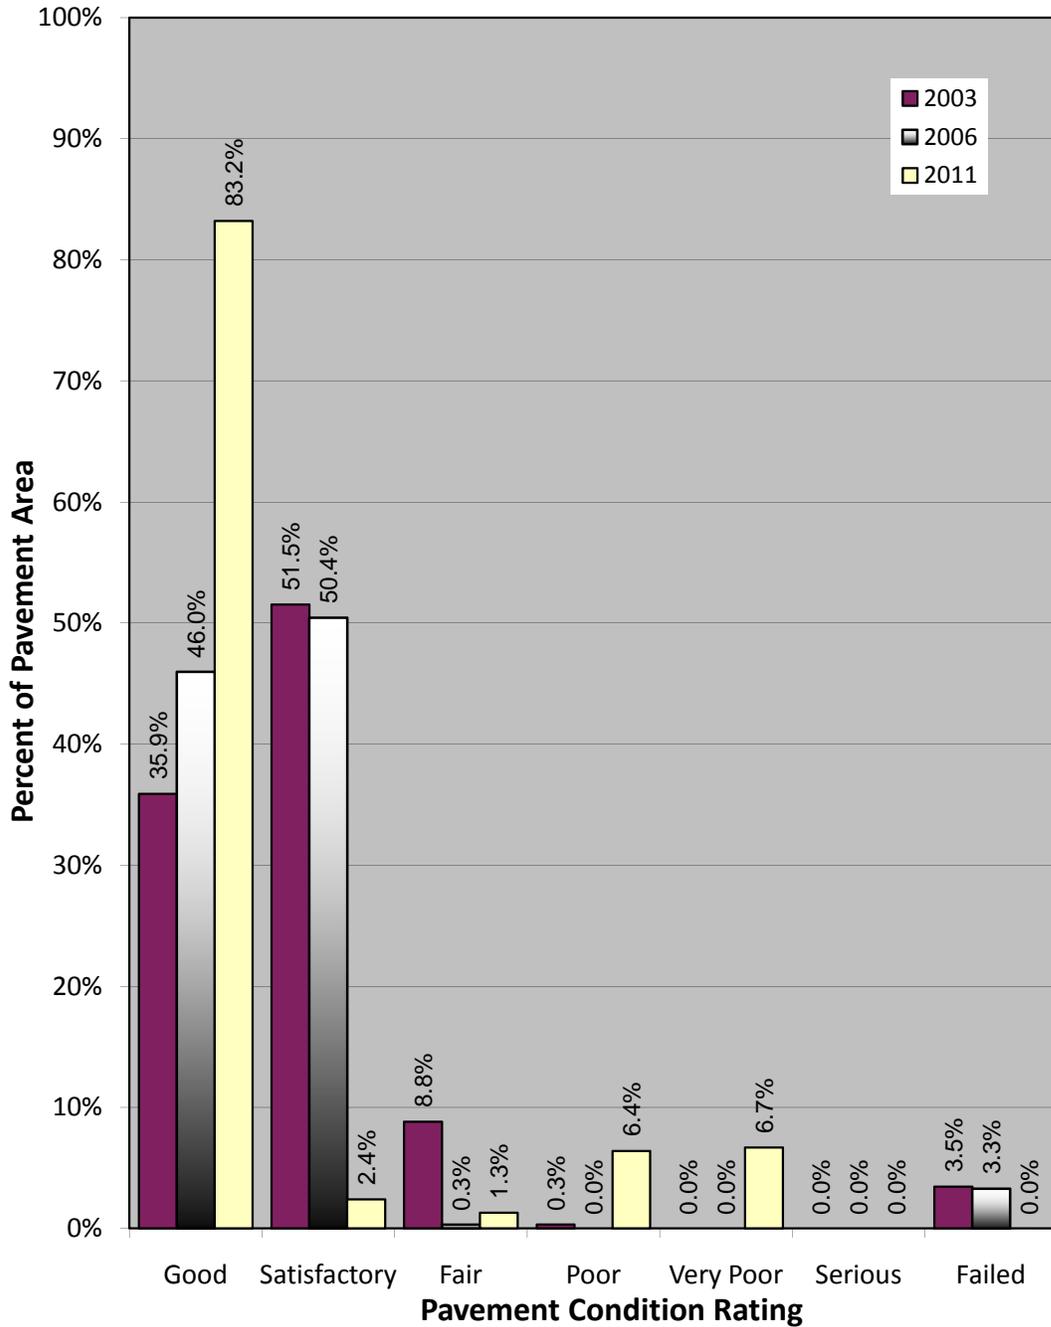


Predicted Condition in 2016.

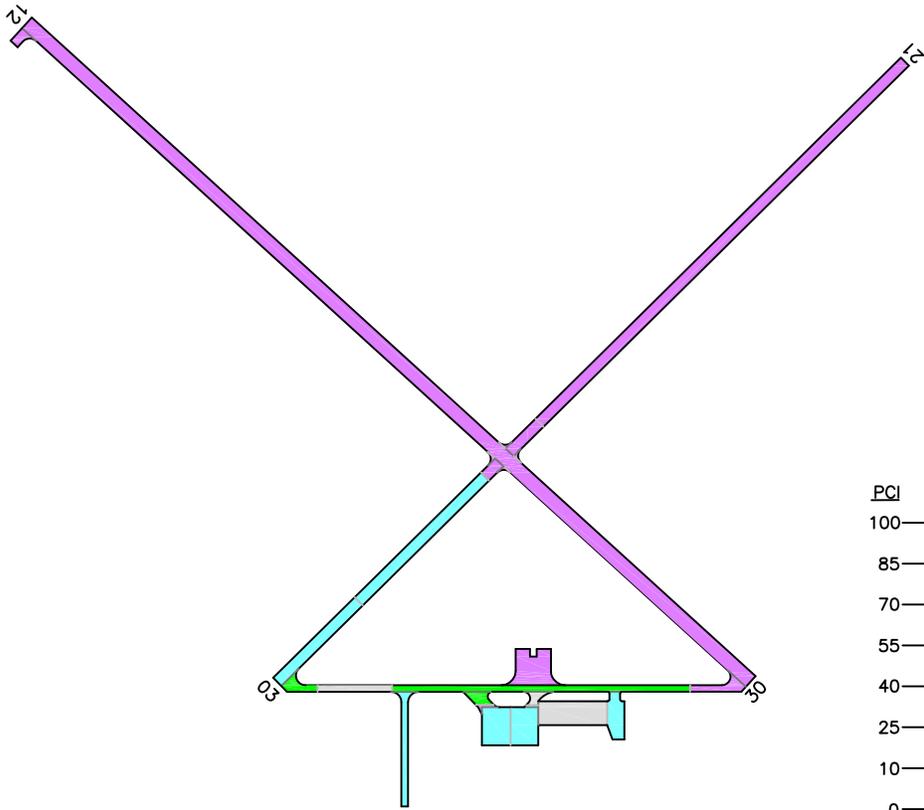

PCI	PCR
100	GOOD
85	SATISFACTORY
70	FAIR
55	POOR
40	VERY POOR
25	SERIOUS
10	FAILED
0	

Predicted Condition in 2021.

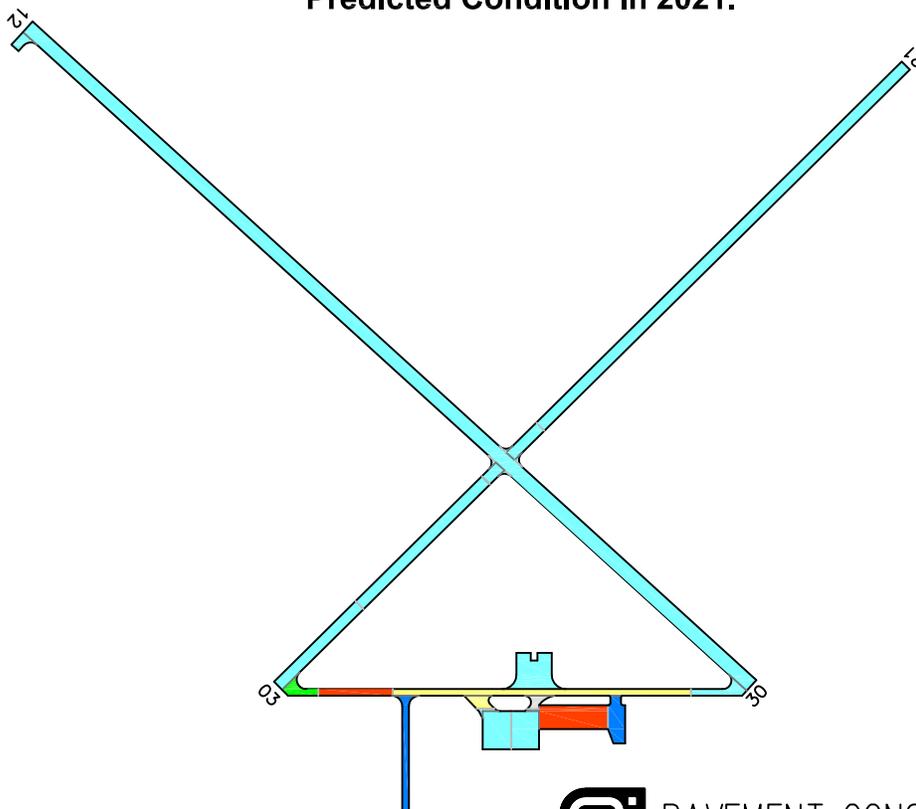

Drawing Date: June 2011

 PAVEMENT CONSULTANTS INC.

Figure BU-5. Future Pavement Condition.

RECOMMENDATIONS

Data collected during the visual condition survey were used by the Micro PAVER software to generate the Network Maintenance Report contained in Appendix 3. This report identifies, for each pavement section, the recommended localized maintenance activities (i.e.-crack sealing, patching) that should be completed to repair the defects observed during the visual inspection. The repair quantities identified in the report were extrapolated to cover the entire pavement section, based on the distresses measured in the inspected sample units. If the repair activities identified are completed, the pavement deterioration rate will be slowed.

The recommended localized maintenance activities to be applied are selected by the Micro PAVER software based on a Distress Maintenance Policy established for the Oregon airport system. The report results indicate that, over your entire airport, the following quantities of localized maintenance are needed:

- 14,170 linear feet of asphalt concrete crack sealing.
- 6 square feet of asphalt concrete shallow patching.
- 1,450 square feet of asphalt concrete deep patching.
- 5 square feet of portland cement concrete partial depth patching.

The Micro PAVER software can also identify and schedule recommended global (applied over an entire section) maintenance activities such as fog seals, slurry seals and other surface treatments, as well as major rehabilitation activities such as asphalt concrete overlays and complete reconstruction. Micro PAVER schedules global maintenance on a user-defined interval. To schedule major rehabilitation Micro PAVER uses pavement deterioration models developed during this project. These models are used to estimate future pavement condition and to schedule rehabilitation based on a trigger PCI.

During this project a 5-year program outlining recommended global maintenance and rehabilitation was developed. The program begins in the year 2012 to allow time for project development. These recommendations are presented in Table 2, which identifies the pavement section requiring rehabilitation, the year the action should be completed, the type of action, and an associated cost. This information is also presented graphically in Figure BU-6.

Table 2. Five-Year Global Maintenance and Rehabilitation Plan.

Year	Branch	Section	Action	Area (sf)	Unit Cost (\$/sf)	Total Cost (\$)
2012	A02BU	01	Reconstruct with 3" AC, 6" CAB, 6" Subbase	45,125	\$3.91	\$176,439
	A02BU	02	Slurry Seal	19,836	\$0.23	\$4,562
	T01BU	01	Slurry Seal	12,484	\$0.23	\$2,871

Table 2. Five-Year Global Maintenance and Rehabilitation Plan.

Year	Branch	Section	Action	Area (sf)	Unit Cost (\$/sf)	Total Cost (\$)
	T01BU	02	Reconstruct with 3" AC, 6" CAB, 6" Subbase	13,650	\$3.91	\$53,372
	T01BU	03	2" AC Overlay	53,854	\$0.23	\$12,386
	T02BU	01	2" AC Overlay	7,174	\$0.23	\$1,650
	T03BU	01	Reconstruct with 3" AC, 6" CAB, 6" Subbase	4,935	\$3.91	\$19,296
	T03BU	02	Slurry Seal	678	\$0.23	\$156
	T04BU	01	Slurry Seal	22,298	\$0.23	\$5,129
2012 Total						\$275,861
2014	AFUELBU	01	Fog Seal	36,072	\$0.12	\$4,329
2014 Total						\$4,329
2016	AH12BU	01	Fog Seal	5,011	\$0.12	\$601
	R12BU	02	Fog Seal	474	\$0.12	\$57
	R12BU	03	Fog Seal	606	\$0.12	\$73
	R12BU	04	Fog Seal	606	\$0.12	\$73
	R12BU	05	Fog Seal	474	\$0.12	\$57
	T01BU	04	Fog Seal	12,483	\$0.12	\$1,498
	T02BU	02	Fog Seal	1,599	\$0.12	\$192
2016 Total						\$2,550
TOTAL						\$282,740


If the global maintenance and/or rehabilitation activities recommended in Table 2 are not completed, the localized maintenance activities identified in the Network Maintenance Report (Appendix 3) for that section should be done. Additionally, for those sections not listed in Table 2 as requiring global maintenance or rehabilitation, the localized maintenance activities outlined in the Network Maintenance Report should be completed. By completing the localized maintenance activities, pavement condition is improved, life is extended, deterioration is slowed and the length of time until major repair or rehabilitation is required is increased.

INSPECTION SCHEDULE



To comply with the inspection schedule requirement of FAA Grant Assurance Number 11, a detailed visual inspection should be conducted every 3 years using the methodology described in ASTM D5430. The next scheduled detailed visual inspection should take place in 2014.

In addition, the FAA requires that a drive-by inspection be conducted monthly to detect unforeseen changes in pavement condition. The results of each drive-by inspection should be

Figure BU-6. Five-Year Pavement Management Plan,
Burns Municipal Airport

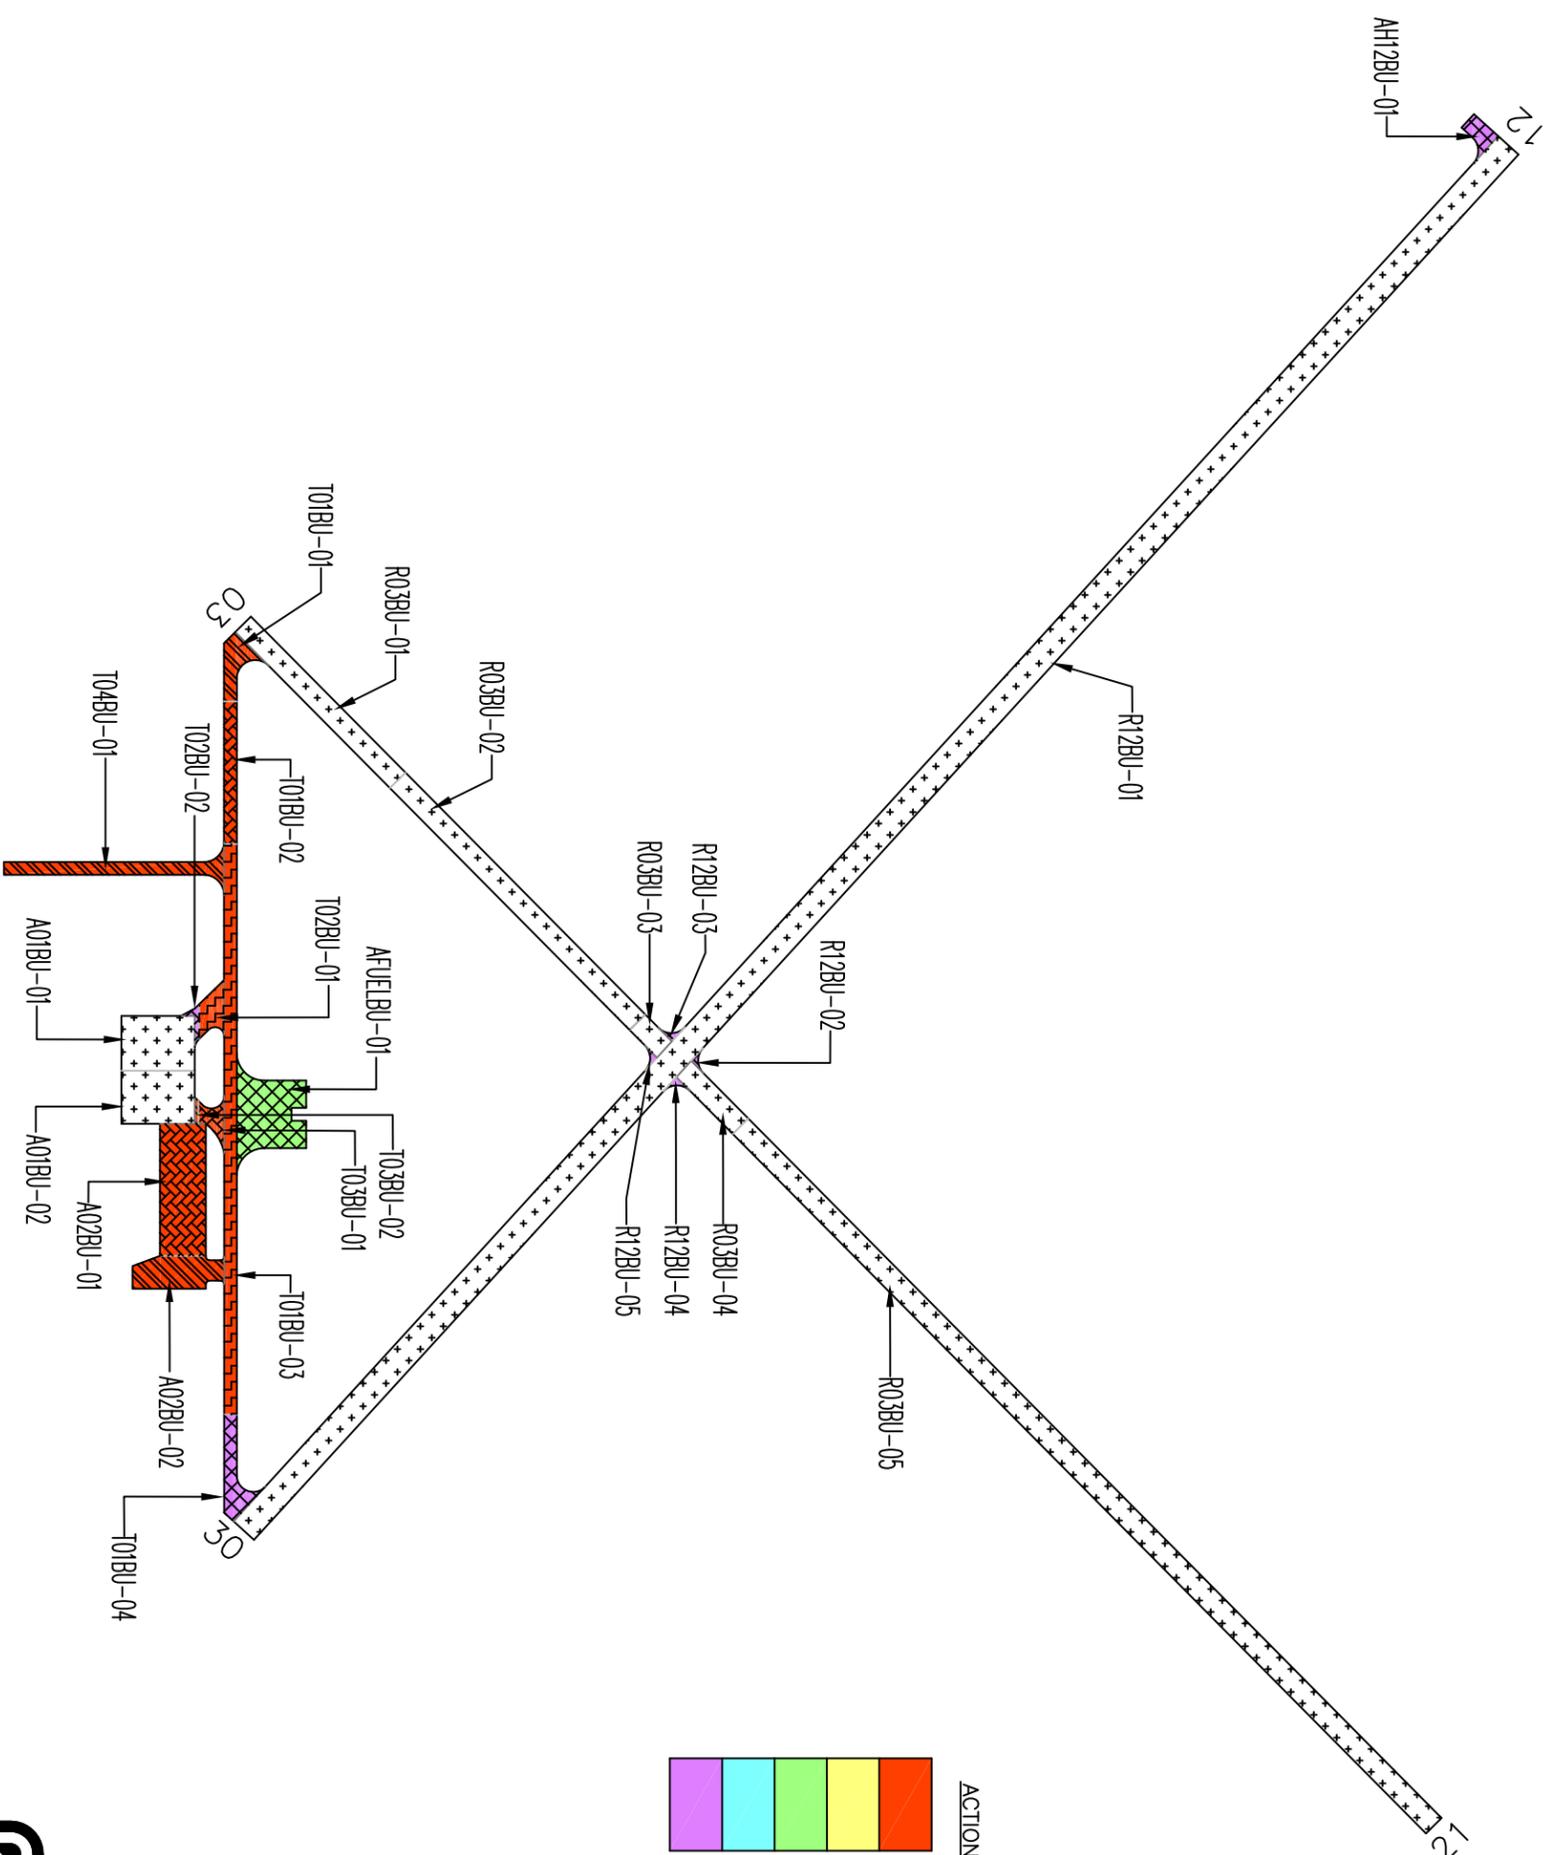

ACTION TIMING		ACTION	
2012	[Red Box]	FOG SEAL	[Cross-hatch Pattern]
2013	[Yellow Box]	SLURRY SEAL	[Diagonal Line Pattern]
2014	[Green Box]	OVERLAY	[Wavy Line Pattern]
2015	[Cyan Box]	RECONSTRUCT	[Grid Pattern]
2016	[Purple Box]	ROUTINE MAINTENANCE	[Dotted Pattern]

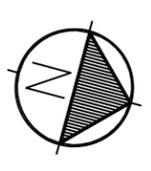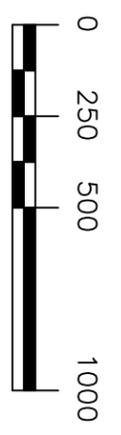

recorded and kept in a file. At a minimum, the date of the inspection and an indication of any maintenance performed since the last drive-by inspection should be recorded.

Appendix 1

Branch Condition Report

Date: 7 /5/2011

Branch Condition Report

1 of 2

Pavement Database: ODOT2011 NetworkID: Burns

Branch ID	Number of Sections	Sum Section Length (Ft)	Avg Section Width (Ft)	True Area (SqFt)	Use	Average PCI	PCI Standard Deviation	Weighted Average PCI
A01BU (Apron 01 Burns)	2	400.00	147.50	59,000.00	APRON	90.00	2.00	90.03
A02BU (Apron 02 Burns)	2	613.00	107.50	64,961.00	APRON	58.50	28.50	47.41
AFUELBU (Fuel Apron)	1	190.00	185.00	36,072.00	APRON	100.00	0.00	100.00
AH12BU (Hold Apron 12 Burns)	1	89.50	50.00	5,011.00	APRON	100.00	0.00	100.00
R03BU (Runway 03/21 Burns)	5	4,545.00	60.00	272,700.00	RUNWAY	93.40	2.58	93.03
R12BU (Runway 12/30 Burns)	5	5,323.00	55.00	386,385.00	RUNWAY	99.20	1.60	96.02
T01BU (Taxiway 01 Burns)	4	2,530.00	35.00	92,471.00	TAXIWAY	62.25	24.16	58.64
T02BU (Taxiway 02 Burns)	2	171.00	53.75	8,773.00	TAXIWAY	75.50	24.50	59.93
T03BU (Taxiway 03 Burns)	2	151.00	41.50	5,613.00	TAXIWAY	54.50	28.50	32.89
T04BU (Taxiway 04 Burns)	1	600.00	35.00	22,298.00	TAXIWAY	82.00	0.00	82.00

Use Category	Number of Sections	Total Area (SqFt)	Arithmetic Average PCI	Average PCI STD.	Weighted Average PCI
APRON	6	165,044.00	82.83	24.18	75.74
RUNWAY	10	659,085.00	96.30	3.61	94.78
TAXIWAY	9	129,155.00	65.67	25.64	61.64
All	25	953,284.00	82.04	23.67	86.99

Appendix 2
Section Condition Report

Date: 7 /5/2011

Section Condition Report

1 of 2

Pavement Database: ODOT2011 NetworkID: Burns

Branch ID	Section ID	Last Const. Date	Surface	Use	Rank	Lanes	True Area (SqFt)	Last Inspection Date	Age At Inspection	PCI
A01BU (Apron 01 Burns)	01	09/03/2010	PCC	APRON	P	0	30,000.00	05/27/2011	1	92.00
A01BU (Apron 01 Burns)	02	09/03/2000	PCC	APRON	P	0	29,000.00	05/27/2011	11	88.00
A02BU (Apron 02 Burns)	01	09/03/1980	AC	APRON	P	0	45,125.00	05/27/2011	31	30.00
A02BU (Apron 02 Burns)	02	06/01/2005	AC	APRON	P	0	19,836.00	05/27/2011	6	87.00
AFUELBU (Fuel Apron)	01	09/02/2008	AC	APRON	S	0	36,072.00	05/27/2011	3	100.00
AH12BU (Hold Apron 12 Burns)	01	09/01/2010	AAC	APRON	P	0	5,011.00	05/27/2011	1	100.00
R03BU (Runway 03/21 Burns)	01	09/03/2000	PCC	RUNWAY	S	0	36,000.00	05/27/2011	11	90.00
R03BU (Runway 03/21 Burns)	02	09/03/2000	PCC	RUNWAY	S	0	55,800.00	05/27/2011	11	91.00
R03BU (Runway 03/21 Burns)	03	09/02/2010	PCC	RUNWAY	S	0	6,300.00	05/27/2011	1	95.00
R03BU (Runway 03/21 Burns)	04	09/02/2010	PCC	RUNWAY	S	0	13,200.00	05/27/2011	1	97.00
R03BU (Runway 03/21 Burns)	05	09/03/2000	PCC	RUNWAY	S	0	161,400.00	05/27/2011	11	94.00
R12BU (Runway 12/30 Burns)	01	09/01/2010	PCC	RUNWAY	P	0	384,225.00	05/27/2011	1	96.00
R12BU (Runway 12/30 Burns)	02	09/02/2010	AAC	RUNWAY	P	0	474.00	05/27/2011	1	100.00
R12BU (Runway 12/30 Burns)	03	09/02/2010	AAC	RUNWAY	P	0	606.00	05/27/2011	1	100.00
R12BU (Runway 12/30 Burns)	04	09/02/2010	AAC	RUNWAY	P	0	606.00	05/27/2011	1	100.00
R12BU (Runway 12/30 Burns)	05	09/02/2010	AAC	RUNWAY	P	0	474.00	05/27/2011	1	100.00
T01BU (Taxiway 01 Burns)	01	09/03/2000	AC	TAXIWAY	P	0	12,484.00	05/27/2011	11	61.00
T01BU (Taxiway 01 Burns)	02	09/03/1988	AC	TAXIWAY	P	0	13,650.00	05/27/2011	23	33.00
T01BU (Taxiway 01 Burns)	03	09/01/1987	AAC	TAXIWAY	P	0	53,854.00	05/27/2011	24	55.00
T01BU (Taxiway 01 Burns)	04	09/01/2010	AAC	TAXIWAY	P	0	12,483.00	05/27/2011	1	100.00
T02BU (Taxiway 02 Burns)	01	09/01/1987	AAC	TAXIWAY	P	0	7,174.00	05/27/2011	24	51.00
T02BU (Taxiway 02 Burns)	02	09/03/2010	AC	TAXIWAY	P	0	1,599.00	05/27/2011	1	100.00
T03BU (Taxiway 03 Burns)	01	09/01/1987	AAC	TAXIWAY	P	0	4,935.00	05/27/2011	24	26.00
T03BU (Taxiway 03 Burns)	02	09/01/2000	AAC	TAXIWAY	P	0	678.00	05/27/2011	11	83.00
T04BU (Taxiway 04 Burns)	01	08/03/2004	AC	TAXIWAY	S	0	22,298.00	05/27/2011	7	82.00

Section Condition Report*Pavement Database: ODOT2011*

Age Category	Average Age At Inspection	Total Area (SqFt)	Number of Sections	Arithmetic Average PCI	PCI Standard Deviation	Weighted Average PCI
0-02	1.00	454,978.00	11	98.18	2.66	95.94
03-05	3.00	36,072.00	1	100.00	0.00	100.00
06-10	6.50	42,134.00	2	84.50	2.50	84.35
11-15	11.00	295,362.00	6	84.50	11.03	90.94
21-25	23.75	79,613.00	4	41.25	12.09	49.07
31-35	31.00	45,125.00	1	30.00	0.00	30.00
All	8.76	953,284.00	25	82.04	23.67	86.99

Appendix 3
Network Maintenance Report

NETWORK MAINTENANCE REPORT BURNS MUNICIPAL AIRPORT

Network	Branch	Section	Distress	Severity	Action	Maint. Quantity	Units	Unit Cost	Total Cost
Burns	A01BU	1	Corner Spall	L	No Localized M & R	9	SqFt	\$0.00	\$0.00
Burns	A01BU	1	Joint Seal Damage	L	No Localized M & R	4,450	SqFt	\$0.00	\$0.00
Burns	A01BU	1	Joint Spall	L	No Localized M & R	74	SqFt	\$0.00	\$0.00
Burns	A01BU	1	Scaling	L	No Localized M & R	176	SqFt	\$0.00	\$0.00
Burns	A01BU	1	Shrinkage Crack	N	No Localized M & R	30	SqFt	\$0.00	\$0.00
Total									\$0.00
Burns	A01BU	2	Corner Break	L	No Localized M & R	86	SqFt	\$0.00	\$0.00
Burns	A01BU	2	Corner Spall	M	No Localized M & R	4	SqFt	\$0.00	\$0.00
Burns	A01BU	2	Corner Spall	L	No Localized M & R	25	SqFt	\$0.00	\$0.00
Burns	A01BU	2	Joint Seal Damage	L	No Localized M & R	4,295	SqFt	\$0.00	\$0.00
Burns	A01BU	2	Joint Spall	M	No Localized M & R	9	SqFt	\$0.00	\$0.00
Burns	A01BU	2	Joint Spall	L	No Localized M & R	75	SqFt	\$0.00	\$0.00
Burns	A01BU	2	Linear Cracking	L	No Localized M & R	109	SqFt	\$0.00	\$0.00
Burns	A01BU	2	Scaling	L	No Localized M & R	205	SqFt	\$0.00	\$0.00
Burns	A01BU	2	Shrinkage Crack	N	No Localized M & R	48	SqFt	\$0.00	\$0.00
Total									\$0.00
Burns	A02BU	1	Block Cracking	M	Crack Sealing - AC	4,126	Ft	\$0.75	\$3,094.63
Burns	A02BU	1	Block Cracking	L	Crack Sealing - AC	2,751	Ft	\$0.75	\$2,063.09
Burns	A02BU	1	Longitudinal & Transverse Cracking	M	Crack Sealing - AC	338	Ft	\$0.75	\$253.83
Burns	A02BU	1	Longitudinal & Transverse Cracking	L	Crack Sealing - AC	1,241	Ft	\$0.75	\$930.69
Burns	A02BU	1	Raveling	M	No Localized M & R	33,844	SqFt	\$0.00	\$0.00
Burns	A02BU	1	Raveling	L	No Localized M & R	45,125	SqFt	\$0.00	\$0.00
Burns	A02BU	1	Weathering	M	No Localized M & R	11,281	SqFt	\$0.00	\$0.00
Total									\$6,342.24

NETWORK MAINTENANCE REPORT BURNS MUNICIPAL AIRPORT

Network	Branch	Section	Distress	Severity	Action	Maint. Quantity	Units	Unit Cost	Total Cost
Burns	A02BU	2	Longitudinal & Transverse Cracking	M	Crack Sealing - AC	200	Ft	\$0.75	\$150.21
Burns	A02BU	2	Longitudinal & Transverse Cracking	L	Crack Sealing - AC	125	Ft	\$0.75	\$93.88
Total									\$244.09
Burns	R03BU	1	Corner Spall	M	No Localized M & R	5	SqFt	\$0.00	\$0.00
Burns	R03BU	1	Corner Spall	L	No Localized M & R	81	SqFt	\$0.00	\$0.00
Burns	R03BU	1	Corner Spall	H	Patching - PCC Partial Depth	5	SqFt	\$100.00	\$504.56
Burns	R03BU	1	Joint Seal Damage	L	No Localized M & R	6,540	SqFt	\$0.00	\$0.00
Burns	R03BU	1	Joint Spall	L	No Localized M & R	146	SqFt	\$0.00	\$0.00
Burns	R03BU	1	Shrinkage Crack	N	No Localized M & R	6	SqFt	\$0.00	\$0.00
Burns	R03BU	1	Small Patch	L	No Localized M & R	20	SqFt	\$0.00	\$0.00
Total									\$504.56
Burns	R03BU	2	Corner Spall	L	No Localized M & R	40	SqFt	\$0.00	\$0.00
Burns	R03BU	2	Corner Spall	M	No Localized M & R	17	SqFt	\$0.00	\$0.00
Burns	R03BU	2	Joint Seal Damage	L	No Localized M & R	10,170	SqFt	\$0.00	\$0.00
Burns	R03BU	2	Joint Spall	M	No Localized M & R	41	SqFt	\$0.00	\$0.00
Burns	R03BU	2	Joint Spall	L	No Localized M & R	80	SqFt	\$0.00	\$0.00
Burns	R03BU	2	Shrinkage Crack	N	No Localized M & R	104	SqFt	\$0.00	\$0.00
Burns	R03BU	2	Small Patch	M	Patching - AC Shallow	6	SqFt	\$15.00	\$85.32
Burns	R03BU	2	Small Patch	L	No Localized M & R	80	SqFt	\$0.00	\$0.00
Total									\$85.32
Burns	R03BU	3	Corner Spall	L	No Localized M & R	3	SqFt	\$0.00	\$0.00
Burns	R03BU	3	Joint Seal Damage	L	No Localized M & R	1,095	SqFt	\$0.00	\$0.00
Burns	R03BU	3	Joint Spall	L	No Localized M & R	3	SqFt	\$0.00	\$0.00
Burns	R03BU	3	Joint Spall	M	No Localized M & R	7	SqFt	\$0.00	\$0.00
Burns	R03BU	3	Small Patch	L	No Localized M & R	5	SqFt	\$0.00	\$0.00
Total									\$0.00

NETWORK MAINTENANCE REPORT BURNS MUNICIPAL AIRPORT

Network	Branch	Section	Distress	Severity	Action	Maint. Quantity	Units	Unit Cost	Total Cost
Burns	R03BU	4	Joint Seal Damage	L	No Localized M & R	2,360	SqFt	\$0.00	\$0.00
Burns	R03BU	4	Shrinkage Crack	N	No Localized M & R	4	SqFt	\$0.00	\$0.00
Burns	R03BU	4	Small Patch	L	No Localized M & R	14	SqFt	\$0.00	\$0.00
Total									\$0.00
Burns	R03BU	5	Corner Spall	L	No Localized M & R	41	SqFt	\$0.00	\$0.00
Burns	R03BU	5	Joint Seal Damage	L	No Localized M & R	29,530	SqFt	\$0.00	\$0.00
Burns	R03BU	5	Joint Spall	M	No Localized M & R	66	SqFt	\$0.00	\$0.00
Burns	R03BU	5	Joint Spall	L	No Localized M & R	314	SqFt	\$0.00	\$0.00
Burns	R03BU	5	Large Patch	L	No Localized M & R	749	SqFt	\$0.00	\$0.00
Burns	R03BU	5	Small Patch	L	No Localized M & R	96	SqFt	\$0.00	\$0.00
Total									\$0.00
Burns	R12BU	1	Joint Seal Damage	L	No Localized M & R	63,963	SqFt	\$0.00	\$0.00
Burns	R12BU	1	Joint Spall	L	No Localized M & R	326	SqFt	\$0.00	\$0.00
Burns	R12BU	1	Large Patch	L	No Localized M & R	1,066	SqFt	\$0.00	\$0.00
Burns	R12BU	1	Small Patch	L	No Localized M & R	280	SqFt	\$0.00	\$0.00
Total									\$0.00
Burns	T01BU	1	Alligator Cracking	L	No Localized M & R	28	SqFt	\$0.00	\$0.00
Burns	T01BU	1	Longitudinal & Transverse Cracking	M	Crack Sealing - AC	387	Ft	\$0.75	\$289.93
Burns	T01BU	1	Raveling	L	No Localized M & R	12,484	SqFt	\$0.00	\$0.00
Burns	T01BU	1	Weathering	L	No Localized M & R	12,484	SqFt	\$0.00	\$0.00
Total									\$289.93

NETWORK MAINTENANCE REPORT BURNS MUNICIPAL AIRPORT

Network	Branch	Section	Distress	Severity	Action	Maint. Quantity	Units	Unit Cost	Total Cost
Burns	T01BU	2	Alligator Cracking	M	Patching - AC Deep	1,449	SqFt	\$15.00	\$21,736.81
Burns	T01BU	2	Alligator Cracking	L	No Localized M & R	1,025	SqFt	\$0.00	\$0.00
Burns	T01BU	2	Longitudinal & Transverse Cracking	L	Crack Sealing - AC	210	Ft	\$0.75	\$157.50
Burns	T01BU	2	Longitudinal & Transverse Cracking	M	Crack Sealing - AC	450	Ft	\$0.75	\$337.50
Burns	T01BU	2	Raveling	L	No Localized M & R	13,650	SqFt	\$0.00	\$0.00
Burns	T01BU	2	Weathering	M	No Localized M & R	13,650	SqFt	\$0.00	\$0.00
Total									\$22,231.81
Burns	T01BU	3	Block Cracking	L	Crack Sealing - AC	441	Ft	\$0.75	\$330.70
Burns	T01BU	3	Longitudinal & Transverse Cracking	M	Crack Sealing - AC	2,247	Ft	\$0.75	\$1,685.33
Burns	T01BU	3	Longitudinal & Transverse Cracking	L	Crack Sealing - AC	96	Ft	\$0.75	\$72.33
Burns	T01BU	3	Patching	L	No Localized M & R	186	SqFt	\$0.00	\$0.00
Burns	T01BU	3	Raveling	L	No Localized M & R	53,854	SqFt	\$0.00	\$0.00
Burns	T01BU	3	Weathering	M	No Localized M & R	53,854	SqFt	\$0.00	\$0.00
Total									\$2,088.36
Burns	T02BU	1	Depression	L	No Localized M & R	108	SqFt	\$0.00	\$0.00
Burns	T02BU	1	Longitudinal & Transverse Cracking	M	Crack Sealing - AC	350	Ft	\$0.75	\$262.53
Burns	T02BU	1	Longitudinal & Transverse Cracking	L	Crack Sealing - AC	25	Ft	\$0.75	\$18.75
Burns	T02BU	1	Raveling	L	No Localized M & R	7,174	SqFt	\$0.00	\$0.00
Burns	T02BU	1	Weathering	M	No Localized M & R	7,174	SqFt	\$0.00	\$0.00
Total									\$281.28
Burns	T03BU	1	Block Cracking	M	Crack Sealing - AC	451	Ft	\$0.75	\$338.32
Burns	T03BU	1	Depression	L	No Localized M & R	27	SqFt	\$0.00	\$0.00
Burns	T03BU	1	Longitudinal & Transverse Cracking	M	Crack Sealing - AC	175	Ft	\$0.75	\$131.25
Burns	T03BU	1	Raveling	M	No Localized M & R	4,935	SqFt	\$0.00	\$0.00
Burns	T03BU	1	Weathering	M	No Localized M & R	4,935	SqFt	\$0.00	\$0.00
Total									\$469.57

NETWORK MAINTENANCE REPORT BURNS MUNICIPAL AIRPORT

Network	Branch	Section	Distress	Severity	Action	Maint. Quantity	Units	Unit Cost	Total Cost
Burns	T03BU	2	Longitudinal & Transverse Cracking	M	Crack Sealing - AC	16	Ft	\$0.75	\$12.00
Total									\$12.00
Burns	T04BU	1	Longitudinal & Transverse Cracking	M	Crack Sealing - AC	497	Ft	\$0.75	\$372.76
Burns	T04BU	1	Longitudinal & Transverse Cracking	L	Crack Sealing - AC	39	Ft	\$0.75	\$29.43
Total									\$402.19
TOTAL									\$32,951.35

Appendix 4
Re-Inspection Report

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: A01BU Name: Apron 01 Burns Use: APRON Area: 59,000.00SqFt

Section: 01 of 2 From: T02BU-01 To: A01BU-02 Last Const.: 09/03/2010
Surface: PCC Family: OR-Cat3-PCC-East-Ap Zone: KBNO Category: P Rank: P
Area: 30,000.00SqFt Length: 200.00Ft Width: 150.00Ft
Slabs: 192 Slab Width: 12.50Ft Slab Length: 12.50Ft Joint Length: 4,450.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 8 Surveyed: 7

Conditions: PCI : 92

Inspection Comments:

Sample Number: 01 Type: R Area: 24.00Slabs PCI = 92

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
70 SCALING/CRAZING	L	3.00 Slabs	Comments:
74 JOINT SPALLING	L	3.00 Slabs	Comments:

Sample Number: 02 Type: R Area: 24.00Slabs PCI = 91

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
74 JOINT SPALLING	L	4.00 Slabs	Comments:
75 CORNER SPALLING	L	1.00 Slabs	Comments:

Sample Number: 03 Type: R Area: 24.00Slabs PCI = 92

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
73 SHRINKAGE CRACKING	N	1.00 Slabs	Comments:
74 JOINT SPALLING	L	4.00 Slabs	Comments:

Sample Number: 04 Type: R Area: 24.00Slabs PCI = 89

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
74 JOINT SPALLING	L	8.00 Slabs	Comments:

Sample Number: 05 Type: R Area: 24.00Slabs PCI = 94

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
73 SHRINKAGE CRACKING	N	4.00 Slabs	Comments:
74 JOINT SPALLING	L	1.00 Slabs	Comments:

Sample Number: 07 Type: R Area: 24.00Slabs PCI = 91

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
73 SHRINKAGE CRACKING	N	2.00 Slabs	Comments:
74 JOINT SPALLING	L	4.00 Slabs	Comments:

Sample Number: 08 Type: R Area: 24.00Slabs PCI = 94

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
73 SHRINKAGE CRACKING	N	1.00 Slabs	Comments:
75 CORNER SPALLING	L	2.00 Slabs	Comments:

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: A01BU Name: Apron 01 Burns Use: APRON Area: 59,000.00SqFt

Section: 02 of 2 From: A01BU-01 To: A02BU-01 Last Const.: 09/03/2000
Surface: PCC Family: OR-Cat3-PCC-East-Ap Zone: KBNO Category: P Rank: P
Area: 29,000.00SqFt Length: 200.00Ft Width: 145.00Ft
Slabs: 224 Slab Width: 12.50Ft Slab Length: 12.50Ft Joint Length: 4,295.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 8 Surveyed: 7

Conditions: PCI: 88

Inspection Comments:

Sample Number: 01 Type: R Area: 24.00Slabs PCI = 85

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
70 SCALING/CRAZING	L	3.00 Slabs	Comments:
73 SHRINKAGE CRACKING	N	1.00 Slabs	Comments:
74 JOINT SPALLING	L	5.00 Slabs	Comments:
75 CORNER SPALLING	L	2.00 Slabs	Comments:

Sample Number: 03 Type: R Area: 24.00Slabs PCI = 93

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
73 SHRINKAGE CRACKING	N	2.00 Slabs	Comments:
74 JOINT SPALLING	L	1.00 Slabs	Comments:
75 CORNER SPALLING	L	1.00 Slabs	Comments:

Sample Number: 04 Type: R Area: 24.00Slabs PCI = 83

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
62 CORNER BREAK	L	2.00 Slabs	Comments:
63 LINEAR CRACKING	L	1.00 Slabs	Comments:
73 SHRINKAGE CRACKING	N	1.00 Slabs	Comments:
74 JOINT SPALLING	L	1.00 Slabs	Comments:
75 CORNER SPALLING	L	1.00 Slabs	Comments:

Sample Number: 05 Type: R Area: 24.00Slabs PCI = 82

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
63 LINEAR CRACKING	L	1.00 Slabs	Comments:
73 SHRINKAGE CRACKING	N	3.00 Slabs	Comments:
74 JOINT SPALLING	L	4.00 Slabs	Comments:
74 JOINT SPALLING	M	1.00 Slabs	Comments:
75 CORNER SPALLING	L	1.00 Slabs	Comments:

Sample Number: 06 Type: R Area: 24.00Slabs PCI = 91

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
73 SHRINKAGE CRACKING	N	1.00 Slabs	Comments:
74 JOINT SPALLING	L	3.00 Slabs	Comments:
75 CORNER SPALLING	L	1.00 Slabs	Comments:

Sample Number: 07 Type: R Area: 24.00Slabs PCI = 92

Sample Comments:

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

65	JOINT SEAL DAMAGE	L	24.00	Slabs	Comments:
73	SHRINKAGE CRACKING	N	2.00	Slabs	Comments:
74	JOINT SPALLING	L	2.00	Slabs	Comments:
75	CORNER SPALLING	L	1.00	Slabs	Comments:

Sample Number: 08 Type: R Area: 24.00Slabs PCI = 88

Sample Comments:

65	JOINT SEAL DAMAGE	L	24.00	Slabs	Comments:
73	SHRINKAGE CRACKING	N	1.00	Slabs	Comments:
74	JOINT SPALLING	L	5.00	Slabs	Comments:
75	CORNER SPALLING	M	1.00	Slabs	Comments:

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: A02BU Name: Apron 02 Burns Use: APRON Area: 64,961.00SqFt

Section: 01 of 2 From: A01BU-02 To: END Last Const.: 09/03/1980
Surface: AC Family: OR-Cat3-AC-East-Ap Zone: KBNO Category: P Rank: P
Area: 45,125.00SqFt Length: 363.00Ft Width: 125.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 9 Surveyed: 4

Conditions: PCI : 30

Inspection Comments:

Sample Number: 02 Type: R Area: 5,000.00SqFt PCI = 28

Sample Comments:

48	LONGITUDINAL/TRANSVERSE CRACKING	L	150.00	Ft	Comments:
48	LONGITUDINAL/TRANSVERSE CRACKING	M	150.00	Ft	Comments:
52	RAVELING	L	5,000.00	SqFt	Comments:
52	RAVELING	M	5,000.00	SqFt	Comments:

Sample Number: 04 Type: R Area: 5,000.00SqFt PCI = 33

Sample Comments:

48	LONGITUDINAL/TRANSVERSE CRACKING	L	150.00	Ft	Comments:
48	LONGITUDINAL/TRANSVERSE CRACKING	L	250.00	Ft	Comments:
52	RAVELING	L	5,000.00	SqFt	Comments:
52	RAVELING	M	5,000.00	SqFt	Comments:

Sample Number: 05 Type: R Area: 5,000.00SqFt PCI = 21

Sample Comments:

43	BLOCK CRACKING	L	2,000.00	SqFt	Comments:
43	BLOCK CRACKING	M	3,000.00	SqFt	Comments:
52	RAVELING	L	5,000.00	SqFt	Comments:
52	RAVELING	M	5,000.00	SqFt	Comments:

Sample Number: 06 Type: R Area: 5,000.00SqFt PCI = 37

Sample Comments:

43	BLOCK CRACKING	L	2,000.00	SqFt	Comments:
43	BLOCK CRACKING	M	3,000.00	SqFt	Comments:
52	RAVELING	L	5,000.00	SqFt	Comments:
57	WEATHERING	M	5,000.00	SqFt	Comments:

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: A02BU Name: Apron 02 Burns Use: APRON Area: 64,961.00SqFt

Section: 02 of 2 From: Taxiway 01 To: Section 01 Last Const.: 06/01/2005
Surface: AC Family: OR-Cat3-AC-East-AP Zone: KBNO Category: P Rank: P
Area: 19,836.00SqFt Length: 250.00Ft Width: 90.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 5 Surveyed: 3

Conditions: PCI : 87

Inspection Comments:

Sample Number: 01 Type: R Area: 2,885.00SqFt PCI = 79

Sample Comments:

48 LONGITUDINAL/TRANSVERSE CRACKING L 30.00 Ft Comments:

48 LONGITUDINAL/TRANSVERSE CRACKING M 60.00 Ft Comments:

Sample Number: 02 Type: R Area: 4,500.00SqFt PCI = 83

Sample Comments:

48 LONGITUDINAL/TRANSVERSE CRACKING L 20.00 Ft Comments:

48 LONGITUDINAL/TRANSVERSE CRACKING M 60.00 Ft Comments:

Sample Number: 03 Type: R Area: 4,500.00SqFt PCI = 96

Sample Comments:

48 LONGITUDINAL/TRANSVERSE CRACKING L 25.00 Ft Comments:

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: AFUELBU Name: Fuel Apron Use: APRON Area: 36,072.00SqFt

Section: 01 of 1 From: T01BU-03 To: - Last Const.: 09/02/2008

Surface: AC Family: OR-Cat3-AC-East-Ap Zone: Category: Rank: S

Area: 36,072.00SqFt Length: 190.00Ft Width: 185.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 6 Surveyed: 6

Conditions: PCI: 100

Inspection Comments:

Sample Number: 01 Type: R Area: 4,625.00SqFt PCI = 100

Sample Comments:
<NO DISTRESSES>

Sample Number: 02 Type: R Area: 4,622.00SqFt PCI = 100

Sample Comments:
<NO DISTRESSES>

Sample Number: 03 Type: R Area: 5,748.00SqFt PCI = 100

Sample Comments:
<NO DISTRESSES>

Sample Number: 04 Type: R Area: 4,625.00SqFt PCI = 100

Sample Comments:
<NO DISTRESSES>

Sample Number: 05 Type: R Area: 4,662.00SqFt PCI = 100

Sample Comments:
<NO DISTRESSES>

Sample Number: 06 Type: R Area: 5,748.00SqFt PCI = 100

Sample Comments:
<NO DISTRESSES>

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: AH12BU Name: Hold Apron 12 Burns Use: APRON Area: 5,011.00SqFt

Section: 01 of 1 From: R12BU-01, 12 End To: West End Last Const.: 09/01/2010
Surface: AAC Family: OR-Cat3-AAC-East-Ap Zone: KBNO Category: P Rank: P
Area: 5,011.00SqFt Length: 89.50Ft Width: 50.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 1 Surveyed: 1

Conditions: PCI: 100

Inspection Comments:

Sample Number: 01 Type: R Area: 5,011.00SqFt PCI = 100

Sample Comments:

<NO DISTRESSES>

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: R03BU Name: Runway 03/21 Burns Use: RUNWAY Area: 272,700.00SqFt

Section: 01 of 5 From: T01BU-01 To: R03BU-02 Last Const.: 09/03/2000
Surface: PCC Family: OR-Cat3-PCC-East-RW Zone: KBNO Category: P Rank: S
Area: 36,000.00SqFt Length: 600.00Ft Width: 60.00Ft
Slabs: 360 Slab Width: 10.00Ft Slab Length: 10.00Ft Joint Length: 6,540.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 15 Surveyed: 8

Conditions: PCI : 90

Inspection Comments:

Sample Number: 01 Type: R Area: 24.00Slabs PCI = 82

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
73 SHRINKAGE CRACKING	N	1.00 Slabs	Comments:
74 JOINT SPALLING	L	9.00 Slabs	Comments:
75 CORNER SPALLING	L	7.00 Slabs	Comments:

Sample Number: 03 Type: R Area: 24.00Slabs PCI = 92

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
74 JOINT SPALLING	L	2.00 Slabs	Comments:
75 CORNER SPALLING	L	2.00 Slabs	Comments:

Sample Number: 05 Type: R Area: 24.00Slabs PCI = 92

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
66 SMALL PATCH	L	2.00 Slabs	Comments:
74 JOINT SPALLING	L	1.00 Slabs	Comments:
75 CORNER SPALLING	L	2.00 Slabs	Comments:

Sample Number: 07 Type: R Area: 24.00Slabs PCI = 98

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
----------------------	---	-------------	-----------

Sample Number: 09 Type: R Area: 24.00Slabs PCI = 92

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
74 JOINT SPALLING	L	5.00 Slabs	Comments:

Sample Number: 11 Type: R Area: 24.00Slabs PCI = 88

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
66 SMALL PATCH	L	1.00 Slabs	Comments:
74 JOINT SPALLING	L	5.00 Slabs	Comments:
75 CORNER SPALLING	L	2.00 Slabs	Comments:

Sample Number: 13 Type: R Area: 24.00Slabs PCI = 90

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
66 SMALL PATCH	L	1.00 Slabs	Comments:
74 JOINT SPALLING	L	4.00 Slabs	Comments:
75 CORNER SPALLING	L	1.00 Slabs	Comments:

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Sample Number:	15	Type:	R	Area:	24.00Slabs	PCI =	83
Sample Comments:							
65	JOINT SEAL DAMAGE			L	24.00 Slabs	Comments:	
74	JOINT SPALLING			L	3.00 Slabs	Comments:	
75	CORNER SPALLING			L	2.00 Slabs	Comments:	
75	CORNER SPALLING			M	1.00 Slabs	Comments:	
75	CORNER SPALLING			H	1.00 Slabs	Comments:	

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: R03BU Name: Runway 03/21 Burns Use: RUNWAY Area: 272,700.00SqFt

Section: 02 of 5 From: R03BU-01 To: R03BU-03 Last Const.: 09/03/2000
Surface: PCC Family: OR-Cat3-PCC-East-RW Zone: KBNO Category: P Rank: S
Area: 55,800.00SqFt Length: 930.00Ft Width: 60.00Ft
Slabs: 558 Slab Width: 10.00Ft Slab Length: 10.00Ft Joint Length: 10,170.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 23 Surveyed: 11

Conditions: PCI : 91

Inspection Comments:

Sample Number: 02 Type: R Area: 24.00Slabs PCI = 87

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
66 SMALL PATCH	L	1.00 Slabs	Comments:
73 SHRINKAGE CRACKING	N	1.00 Slabs	Comments:
74 JOINT SPALLING	L	1.00 Slabs	Comments:
74 JOINT SPALLING	M	1.00 Slabs	Comments:
75 CORNER SPALLING	L	3.00 Slabs	Comments:

Sample Number: 04 Type: R Area: 24.00Slabs PCI = 90

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
66 SMALL PATCH	L	1.00 Slabs	Comments:
73 SHRINKAGE CRACKING	N	5.00 Slabs	Comments:
74 JOINT SPALLING	L	3.00 Slabs	Comments:

Sample Number: 06 Type: R Area: 24.00Slabs PCI = 94

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
73 SHRINKAGE CRACKING	N	3.00 Slabs	Comments:
66 SMALL PATCH	L	3.00 Slabs	Comments:

Sample Number: 08 Type: R Area: 24.00Slabs PCI = 90

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
66 SMALL PATCH	L	1.00 Slabs	Comments:
74 JOINT SPALLING	M	1.00 Slabs	Comments:
75 CORNER SPALLING	L	2.00 Slabs	Comments:

Sample Number: 10 Type: R Area: 24.00Slabs PCI = 89

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
66 SMALL PATCH	L	1.00 Slabs	Comments:
74 JOINT SPALLING	L	2.00 Slabs	Comments:
75 CORNER SPALLING	L	1.00 Slabs	Comments:
75 CORNER SPALLING	M	1.00 Slabs	Comments:

Sample Number: 12 Type: R Area: 24.00Slabs PCI = 87

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
74 JOINT SPALLING	L	3.00 Slabs	Comments:
74 JOINT SPALLING	M	1.00 Slabs	Comments:

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

75 CORNER SPALLING	M	1.00	Slabs	Comments:
--------------------	---	------	-------	-----------

Sample Number: 14	Type: R	Area:	24.00Slabs	PCI = 93
Sample Comments:				
65 JOINT SEAL DAMAGE	L	24.00	Slabs	Comments:
66 SMALL PATCH	L	2.00	Slabs	Comments:
74 JOINT SPALLING	L	3.00	Slabs	Comments:

Sample Number: 16	Type: R	Area:	24.00Slabs	PCI = 92
Sample Comments:				
65 JOINT SEAL DAMAGE	L	24.00	Slabs	Comments:
66 SMALL PATCH	L	2.00	Slabs	Comments:
73 SHRINKAGE CRACKING	N	4.00	Slabs	Comments:
74 JOINT SPALLING	L	1.00	Slabs	Comments:

Sample Number: 18	Type: R	Area:	24.00Slabs	PCI = 96
Sample Comments:				
65 JOINT SEAL DAMAGE	L	24.00	Slabs	Comments:
73 SHRINKAGE CRACKING	N	2.00	Slabs	Comments:

Sample Number: 20	Type: R	Area:	24.00Slabs	PCI = 94
Sample Comments:				
65 JOINT SEAL DAMAGE	L	24.00	Slabs	Comments:
66 SMALL PATCH	L	1.00	Slabs	Comments:
75 CORNER SPALLING	M	1.00	Slabs	Comments:

Sample Number: 22	Type: R	Area:	24.00Slabs	PCI = 91
Sample Comments:				
65 JOINT SEAL DAMAGE	L	24.00	Slabs	Comments:
66 SMALL PATCH	L	2.00	Slabs	Comments:
66 SMALL PATCH	M	1.00	Slabs	Comments:
74 JOINT SPALLING	L	1.00	Slabs	Comments:
75 CORNER SPALLING	L	1.00	Slabs	Comments:

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: R03BU Name: Runway 03/21 Burns Use: RUNWAY Area: 272,700.00SqFt

Section: 03 of 5 From: R03BU-02 To: R12BU-01 Last Const.: 09/02/2010
Surface: PCC Family: OR-Cat3-PCC-East-RW Zone: Category: Rank: S
Area: 6,300.00SqFt Length: 105.00Ft Width: 60.00Ft
Slabs: 60 Slab Width: 10.00Ft Slab Length: 10.00Ft Joint Length: 1,095.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 2 Surveyed: 2

Conditions: PCI : 95

Inspection Comments:

Sample Number: 01 Type: R Area: 30.00Slabs PCI = 93

Sample Comments:

65 JOINT SEAL DAMAGE	L	30.00 Slabs	Comments:
66 SMALL PATCH	L	2.00 Slabs	Comments:
74 JOINT SPALLING	L	1.00 Slabs	Comments:
74 JOINT SPALLING	M	1.00 Slabs	Comments:

Sample Number: 02 Type: R Area: 30.00Slabs PCI = 97

Sample Comments:

65 JOINT SEAL DAMAGE	L	30.00 Slabs	Comments:
75 CORNER SPALLING	L	1.00 Slabs	Comments:

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: R03BU Name: Runway 03/21 Burns Use: RUNWAY Area: 272,700.00SqFt

Section: 04 of 5 From: R12BU-01 To: R03BU-05 Last Const.: 09/02/2010
Surface: PCC Family: OR-Cat3-PCC-East-RW Zone: KBNO Category: P Rank: S
Area: 13,200.00SqFt Length: 220.00Ft Width: 60.00Ft
Slabs: 144 Slab Width: 10.00Ft Slab Length: 10.00Ft Joint Length: 2,360.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 6 Surveyed: 5

Conditions: PCI : 97

Inspection Comments:

Sample Number: 01 Type: R Area: 24.00Slabs PCI = 97

Sample Comments:

65 JOINT SEAL DAMAGE L 24.00 Slabs Comments:
66 SMALL PATCH L 1.00 Slabs Comments:

Sample Number: 02 Type: R Area: 24.00Slabs PCI = 98

Sample Comments:

65 JOINT SEAL DAMAGE L 24.00 Slabs Comments:

Sample Number: 03 Type: R Area: 24.00Slabs PCI = 97

Sample Comments:

65 JOINT SEAL DAMAGE L 24.00 Slabs Comments:
66 SMALL PATCH L 1.00 Slabs Comments:

Sample Number: 04 Type: R Area: 24.00Slabs PCI = 96

Sample Comments:

65 JOINT SEAL DAMAGE L 24.00 Slabs Comments:
66 SMALL PATCH L 2.00 Slabs Comments:
73 SHRINKAGE CRACKING N 1.00 Slabs Comments:

Sample Number: 06 Type: R Area: 18.00Slabs PCI = 98

Sample Comments:

65 JOINT SEAL DAMAGE L 18.00 Slabs Comments:

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: R03BU Name: Runway 03/21 Burns Use: RUNWAY Area: 272,700.00SqFt

Section: 05 of 5 From: R03BU-04 To: Runway 21 End Last Const.: 09/03/2000
Surface: PCC Family: OR-Cat3-PCC-East-RW Zone: KBNO Category: P Rank: S
Area: 161,400.00SqFt Length: 2,690.00Ft Width: 60.00Ft
Slabs: 1,614 Slab Width: 10.00Ft Slab Length: 10.00Ft Joint Length: 29,530.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 67 Surveyed: 13

Conditions: PCI : 94

Inspection Comments:

Sample Number: 01 Type: R Area: 24.00Slabs PCI = 80

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
66 SMALL PATCH	L	5.00 Slabs	Comments:
67 LARGE PATCH/UTILITY	L	3.00 Slabs	Comments:
74 JOINT SPALLING	L	3.00 Slabs	Comments:
74 JOINT SPALLING	M	1.00 Slabs	Comments:

Sample Number: 02 Type: R Area: 24.00Slabs PCI = 91

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
66 SMALL PATCH	L	1.00 Slabs	Comments:
74 JOINT SPALLING	L	1.00 Slabs	Comments:
74 JOINT SPALLING	M	1.00 Slabs	Comments:
75 CORNER SPALLING	L	1.00 Slabs	Comments:

Sample Number: 07 Type: R Area: 24.00Slabs PCI = 95

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
74 JOINT SPALLING	L	2.00 Slabs	Comments:

Sample Number: 13 Type: R Area: 24.00Slabs PCI = 91

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
66 SMALL PATCH	L	1.00 Slabs	Comments:
74 JOINT SPALLING	L	2.00 Slabs	Comments:
75 CORNER SPALLING	L	2.00 Slabs	Comments:

Sample Number: 19 Type: R Area: 24.00Slabs PCI = 95

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
74 JOINT SPALLING	L	2.00 Slabs	Comments:

Sample Number: 25 Type: R Area: 24.00Slabs PCI = 97

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
74 JOINT SPALLING	L	1.00 Slabs	Comments:

Sample Number: 31 Type: R Area: 24.00Slabs PCI = 98

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
----------------------	---	-------------	-----------

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Sample Number:	37	Type:	R	Area:	24.00Slabs	PCI = 91
Sample Comments:						
65	JOINT SEAL DAMAGE			L	24.00 Slabs	Comments:
74	JOINT SPALLING			L	6.00 Slabs	Comments:

Sample Number:	43	Type:	R	Area:	24.00Slabs	PCI = 97
Sample Comments:						
65	JOINT SEAL DAMAGE			L	24.00 Slabs	Comments:
74	JOINT SPALLING			L	1.00 Slabs	Comments:

Sample Number:	49	Type:	R	Area:	24.00Slabs	PCI = 98
Sample Comments:						
65	JOINT SEAL DAMAGE			L	24.00 Slabs	Comments:

Sample Number:	55	Type:	R	Area:	24.00Slabs	PCI = 98
Sample Comments:						
65	JOINT SEAL DAMAGE			L	24.00 Slabs	Comments:

Sample Number:	61	Type:	R	Area:	24.00Slabs	PCI = 95
Sample Comments:						
65	JOINT SEAL DAMAGE			L	24.00 Slabs	Comments:
74	JOINT SPALLING			L	2.00 Slabs	Comments:

Sample Number:	67	Type:	R	Area:	30.00Slabs	PCI = 95
Sample Comments:						
65	JOINT SEAL DAMAGE			L	30.00 Slabs	Comments:
74	JOINT SPALLING			L	3.00 Slabs	Comments:

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: R12BU Name: Runway 12/30 Burns Use: RUNWAY Area: 386,385.00SqFt

Section: 01 of 5 From: Runway 12 End To: Runway 30 End Last Const.: 09/01/2010
Surface: PCC Family: OR-Cat3-PCC-East-RW Zone: KBNO Category: P Rank: P
Area: 384,225.00SqFt Length: 5,123.00Ft Width: 75.00Ft
Slabs: 3,066 Slab Width: 12.50Ft Slab Length: 10.00Ft Joint Length: 63,962.50Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 128 Surveyed: 15

Conditions: PCI: 96

Inspection Comments:

Sample Number: 001 Type: R Area: 24.00Slabs PCI = 98
Sample Comments:
65 JOINT SEAL DAMAGE L 24.00 Slabs Comments:

Sample Number: 012 Type: R Area: 24.00Slabs PCI = 91
Sample Comments:
65 JOINT SEAL DAMAGE L 24.00 Slabs Comments:
66 SMALL PATCH L 2.00 Slabs Comments:
67 LARGE PATCH/UTILITY L 2.00 Slabs Comments:

Sample Number: 023 Type: R Area: 24.00Slabs PCI = 94
Sample Comments:
65 JOINT SEAL DAMAGE L 24.00 Slabs Comments:
74 JOINT SPALLING L 3.00 Slabs Comments:

Sample Number: 034 Type: R Area: 24.00Slabs PCI = 97
Sample Comments:
65 JOINT SEAL DAMAGE L 24.00 Slabs Comments:
66 SMALL PATCH L 1.00 Slabs Comments:

Sample Number: 045 Type: R Area: 24.00Slabs PCI = 98
Sample Comments:
65 JOINT SEAL DAMAGE L 24.00 Slabs Comments:

Sample Number: 056 Type: R Area: 24.00Slabs PCI = 96
Sample Comments:
65 JOINT SEAL DAMAGE L 24.00 Slabs Comments:
66 SMALL PATCH L 1.00 Slabs Comments:
74 JOINT SPALLING L 1.00 Slabs Comments:

Sample Number: 067 Type: R Area: 24.00Slabs PCI = 94
Sample Comments:
65 JOINT SEAL DAMAGE L 24.00 Slabs Comments:
74 JOINT SPALLING L 3.00 Slabs Comments:

Sample Number: 078 Type: R Area: 24.00Slabs PCI = 97
Sample Comments:
65 JOINT SEAL DAMAGE L 24.00 Slabs Comments:
66 SMALL PATCH L 1.00 Slabs Comments:

Sample Number: 084 Type: R Area: 24.00Slabs PCI = 95
Sample Comments:

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
74 JOINT SPALLING	L	2.00 Slabs	Comments:

Sample Number: 085 Type: R Area: 24.00Slabs PCI = 97

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
74 JOINT SPALLING	L	1.00 Slabs	Comments:

Sample Number: 089 Type: R Area: 24.00Slabs PCI = 96

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
66 SMALL PATCH	L	1.00 Slabs	Comments:
74 JOINT SPALLING	L	1.00 Slabs	Comments:

Sample Number: 100 Type: R Area: 24.00Slabs PCI = 96

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
66 SMALL PATCH	L	1.00 Slabs	Comments:
74 JOINT SPALLING	L	1.00 Slabs	Comments:

Sample Number: 111 Type: R Area: 24.00Slabs PCI = 96

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
66 SMALL PATCH	L	1.00 Slabs	Comments:
74 JOINT SPALLING	L	1.00 Slabs	Comments:

Sample Number: 112 Type: R Area: 24.00Slabs PCI = 95

Sample Comments:

65 JOINT SEAL DAMAGE	L	24.00 Slabs	Comments:
66 SMALL PATCH	L	4.00 Slabs	Comments:

Sample Number: 128 Type: R Area: 18.00Slabs PCI = 96

Sample Comments:

65 JOINT SEAL DAMAGE	L	18.00 Slabs	Comments:
74 JOINT SPALLING	L	1.00 Slabs	Comments:

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: R12BU Name: Runway 12/30 Burns Use: RUNWAY Area: 386,385.00SqFt

Section: 02 of 5 From: R03BU To: R12BU Last Const.: 09/02/2010

Surface: AAC Family: OR-Cat3-AAC-East-RW Zone: KBNO Category: P Rank: P

Area: 474.00SqFt Length: 50.00Ft Width: 50.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 1 Surveyed: 1

Conditions: PCI: 100

Inspection Comments:

Sample Number: 01 Type: R Area: 474.00SqFt PCI = 100

Sample Comments:

<NO DISTRESSES>

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: R12BU Name: Runway 12/30 Burns Use: RUNWAY Area: 386,385.00SqFt

Section: 03 of 5 From: R03BU To: R12BU Last Const.: 09/02/2010
Surface: AAC Family: OR-Cat3-AAC-East-RW Zone: KBNO Category: P Rank: P
Area: 606.00SqFt Length: 50.00Ft Width: 50.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 1 Surveyed: 1

Conditions: PCI: 100

Inspection Comments:

Sample Number: 01 Type: R Area: 606.00SqFt PCI = 100

Sample Comments:

<NO DISTRESSES>

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: R12BU Name: Runway 12/30 Burns Use: RUNWAY Area: 386,385.00SqFt

Section: 04 of 5 From: R03BU To: R12BU Last Const.: 09/02/2010

Surface: AAC Family: OR-Cat3-AAC-East-RW Zone: KBNO Category: P Rank: P

Area: 606.00SqFt Length: 50.00Ft Width: 50.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 1 Surveyed: 1

Conditions: PCI: 100

Inspection Comments:

Sample Number: 01 Type: R Area: 606.00SqFt PCI = 100

Sample Comments:

<NO DISTRESSES>

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: R12BU Name: Runway 12/30 Burns Use: RUNWAY Area: 386,385.00SqFt

Section: 05 of 5 From: R03BU To: R12BU Last Const.: 09/02/2010

Surface: AAC Family: OR-Cat3-AAC-East-RW Zone: KBNO Category: P Rank: P

Area: 474.00SqFt Length: 50.00Ft Width: 50.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 1 Surveyed: 1

Conditions: PCI: 100

Inspection Comments:

Sample Number: 01 Type: R Area: 474.00SqFt PCI = 100

Sample Comments:

<NO DISTRESSES>

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: T01BU Name: Taxiway 01 Burns Use: TAXIWAY Area: 92,471.00SqFt

Section: 01 of 4 From: R12BU-01, 30 End To: T01BU-03 Last Const.: 09/03/2000
Surface: AC Family: OR-Cat3-AC-East-TW Zone: KBNO Category: P Rank: P
Area: 12,484.00SqFt Length: 290.00Ft Width: 35.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 2 Surveyed: 2

Conditions: PCI : 61

Inspection Comments:

Sample Number: 01 Type: R Area: 3,854.00SqFt PCI = 64

Sample Comments:

48	LONGITUDINAL/TRANSVERSE CRACKING	M	160.00 Ft	Comments:
52	RAVELING	L	3,854.00 SqFt	Comments:
57	WEATHERING	L	3,854.00 SqFt	Comments:

Sample Number: 02 Type: R Area: 5,511.00SqFt PCI = 59

Sample Comments:

48	LONGITUDINAL/TRANSVERSE CRACKING	M	130.00 Ft	Comments:
52	RAVELING	L	5,511.00 SqFt	Comments:
57	WEATHERING	L	5,511.00 SqFt	Comments:
41	ALLIGATOR CRACKING	L	8.00 SqFt	Comments:

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: T01BU Name: Taxiway 01 Burns Use: TAXIWAY Area: 92,471.00SqFt

Section: 02 of 4 From: T01-01 To: T01-03 Last Const.: 09/03/1988
Surface: AC Family: OR-Cat3-AC-East-TW Zone: KBNO Category: P Rank: P
Area: 13,650.00SqFt Length: 390.00Ft Width: 35.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 3 Surveyed: 3

Conditions: PCI : 33

Inspection Comments:

Sample Number: 01 Type: R Area: 5,250.00SqFt PCI = 33

Sample Comments:

48 LONGITUDINAL/TRANSVERSE CRACKING	M	310.00 Ft	Comments:
41 ALLIGATOR CRACKING	L	900.00 SqFt	Comments:
52 RAVELING	L	5,250.00 SqFt	Comments:
57 WEATHERING	M	5,250.00 SqFt	Comments:

Sample Number: 02 Type: R Area: 5,250.00SqFt PCI = 17

Sample Comments:

41 ALLIGATOR CRACKING	M	1,300.00 SqFt	Comments:
48 LONGITUDINAL/TRANSVERSE CRACKING	L	150.00 Ft	Comments:
48 LONGITUDINAL/TRANSVERSE CRACKING	M	105.00 Ft	Comments:
52 RAVELING	L	5,250.00 SqFt	Comments:
57 WEATHERING	M	5,250.00 SqFt	Comments:

Sample Number: 03 Type: R Area: 3,150.00SqFt PCI = 59

Sample Comments:

48 LONGITUDINAL/TRANSVERSE CRACKING	L	60.00 Ft	Comments:
48 LONGITUDINAL/TRANSVERSE CRACKING	M	35.00 Ft	Comments:
52 RAVELING	L	3,150.00 SqFt	Comments:
57 WEATHERING	M	3,150.00 SqFt	Comments:

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: T01BU Name: Taxiway 01 Burns Use: TAXIWAY Area: 92,471.00SqFt

Section: 03 of 4 From: T01BU-02 To: T01BU-04 Last Const.: 09/01/1987

Surface: AAC Family: OR-Cat3-AAC-East-TW Zone: KBNO Category: P Rank: P

Area: 53,854.00SqFt Length: 1,560.00Ft Width: 35.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 10 Surveyed: 5

Conditions: PCI : 55

Inspection Comments:

Sample Number: 02 Type: R Area: 5,250.00SqFt PCI = 55

Sample Comments:

48 LONGITUDINAL/TRANSVERSE CRACKING M 275.00 Ft Comments:

52 RAVELING L 5,250.00 SqFt Comments:

57 WEATHERING M 5,250.00 SqFt Comments:

Sample Number: 04 Type: R Area: 5,161.00SqFt PCI = 52

Sample Comments:

48 LONGITUDINAL/TRANSVERSE CRACKING M 360.00 Ft Comments:

52 RAVELING L 5,161.00 SqFt Comments:

57 WEATHERING M 5,161.00 SqFt Comments:

Sample Number: 06 Type: R Area: 5,149.00SqFt PCI = 53

Sample Comments:

48 LONGITUDINAL/TRANSVERSE CRACKING M 105.00 Ft Comments:

43 BLOCK CRACKING L 750.00 SqFt Comments:

52 RAVELING L 5,149.00 SqFt Comments:

57 WEATHERING M 5,149.00 SqFt Comments:

50 PATCHING L 70.00 SqFt Comments:

Sample Number: 08 Type: R Area: 5,149.00SqFt PCI = 57

Sample Comments:

48 LONGITUDINAL/TRANSVERSE CRACKING M 210.00 Ft Comments:

52 RAVELING L 5,149.00 SqFt Comments:

57 WEATHERING M 5,149.00 SqFt Comments:

Sample Number: 10 Type: R Area: 7,211.00SqFt PCI = 57

Sample Comments:

48 LONGITUDINAL/TRANSVERSE CRACKING L 50.00 Ft Comments:

48 LONGITUDINAL/TRANSVERSE CRACKING M 215.00 Ft Comments:

52 RAVELING L 7,211.00 SqFt Comments:

57 WEATHERING M 7,211.00 SqFt Comments:

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: T01BU Name: Taxiway 01 Burns Use: TAXIWAY Area: 92,471.00SqFt

Section: 04 of 4 From: T01-03 To: R30 END Last Const.: 09/01/2010

Surface: AAC Family: OR-Cat3-AAC-East-TW Zone: KBNO Category: P Rank: P

Area: 12,483.00SqFt Length: 290.00Ft Width: 35.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 2 Surveyed: 2

Conditions: PCI: 100

Inspection Comments:

Sample Number: 01 Type: R Area: 5,720.00SqFt PCI = 100

Sample Comments:

<NO DISTRESSES>

Sample Number: 02 Type: R Area: 6,763.00SqFt PCI = 100

Sample Comments:

<NO DISTRESSES>

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: T02BU Name: Taxiway 02 Burns Use: TAXIWAY Area: 8,773.00SqFt

Section: 01 of 2 From: T01BU-03 To: A01BU-01 Last Const.: 09/01/1987

Surface: AAC Family: OR-Cat3-AAC-East-TW Zone: KBNO Category: P Rank: P

Area: 7,174.00SqFt Length: 75.00Ft Width: 95.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 2 Surveyed: 2

Conditions: PCI: 51

Inspection Comments:

Sample Number: 01 Type: R Area: 4,561.00SqFt PCI = 51

Sample Comments:

48 LONGITUDINAL/TRANSVERSE CRACKING L 25.00 Ft Comments:

48 LONGITUDINAL/TRANSVERSE CRACKING M 200.00 Ft Comments:

45 DEPRESSION L 30.00 SqFt Comments:

52 RAVELING L 4,561.00 SqFt Comments:

57 WEATHERING M 4,561.00 SqFt Comments:

Sample Number: 02 Type: R Area: 2,612.00SqFt PCI = 50

Sample Comments:

48 LONGITUDINAL/TRANSVERSE CRACKING M 150.00 Ft Comments:

45 DEPRESSION L 40.00 SqFt Comments:

52 RAVELING L 2,612.00 SqFt Comments:

57 WEATHERING M 2,612.00 SqFt Comments:

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: T02BU Name: Taxiway 02 Burns Use: TAXIWAY Area: 8,773.00SqFt

Section: 02 of 2 From: T02BU-01 To: A01BU-01 Last Const.: 09/03/2010

Surface: AC Family: OR-Cat3-AC-East-TW Zone: KBNO Category: P Rank: P

Area: 1,599.00SqFt Length: 96.00Ft Width: 12.50Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 1 Surveyed: 1

Conditions: PCI: 100

Inspection Comments:

Sample Number: 01 Type: R Area: 1,599.00SqFt PCI = 100

Sample Comments:

<NO DISTRESSES>

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: T03BU Name: Taxiway 03 Burns Use: TAXIWAY Area: 5,613.00SqFt

Section: 01 of 2 From: T01-03 To: T03BU-02 Last Const.: 09/01/1987

Surface: AAC Family: OR-Cat3-AAC-East-TW Zone: KBNO Category: P Rank: P

Area: 4,935.00SqFt Length: 78.00Ft Width: 73.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 2 Surveyed: 2

Conditions: PCI : 26

Inspection Comments:

Sample Number: 01 Type: R Area: 3,357.00SqFt PCI = 27

Sample Comments:

43 BLOCK CRACKING	M	1,007.00 SqFt	Comments:
48 LONGITUDINAL/TRANSVERSE CRACKING	M	100.00 Ft	Comments:
45 DEPRESSION	L	10.00 SqFt	Comments:
52 RAVELING	M	3,357.00 SqFt	Comments:
57 WEATHERING	M	3,357.00 SqFt	Comments:

Sample Number: 02 Type: R Area: 1,578.00SqFt PCI = 26

Sample Comments:

43 BLOCK CRACKING	M	473.00 SqFt	Comments:
48 LONGITUDINAL/TRANSVERSE CRACKING	M	75.00 Ft	Comments:
52 RAVELING	M	1,578.00 SqFt	Comments:
57 WEATHERING	M	1,578.00 SqFt	Comments:

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: T03BU Name: Taxiway 03 Burns Use: TAXIWAY Area: 5,613.00SqFt

Section: 02 of 2 From: T03BU-01 To: A01BU-02 Last Const.: 09/01/2000

Surface: AAC Family: OR-Cat3-AAC-East-TW Zone: KBNO Category: P Rank: P

Area: 678.00SqFt Length: 73.00Ft Width: 10.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 1 Surveyed: 1

Conditions: PCI : 83

Inspection Comments:

Sample Number: 01 Type: R Area: 678.00SqFt PCI = 83

Sample Comments:

48 LONGITUDINAL/TRANSVERSE CRACKING M 16.00 Ft Comments:

Re-inspection Report

ODOT2011

Report Generated Date: July 06, 2011

Network: Burns Name: Burns Municipal

Branch: T04BU Name: Taxiway 04 Burns Use: TAXIWAY Area: 22,298.00SqFt

Section: 01 of 1 From: T01BU-03 To: END Last Const.: 08/03/2004

Surface: AC Family: OR-Cat3-AC-East-TW Zone: KBNO Category: P Rank: S

Area: 22,298.00SqFt Length: 600.00Ft Width: 35.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Section Comments:

Last Insp. Date: 05/27/2011 Total Samples: 4 Surveyed: 3

Conditions: PCI: 82

Inspection Comments:

Sample Number: 01 Type: R Area: 6,548.00SqFt PCI = 84

Sample Comments:

48 LONGITUDINAL/TRANSVERSE CRACKING L 30.00 Ft Comments:

48 LONGITUDINAL/TRANSVERSE CRACKING M 80.00 Ft Comments:

Sample Number: 03 Type: R Area: 5,250.00SqFt PCI = 81

Sample Comments:

48 LONGITUDINAL/TRANSVERSE CRACKING M 150.00 Ft Comments:

Sample Number: 04 Type: R Area: 5,250.00SqFt PCI = 81

Sample Comments:

48 LONGITUDINAL/TRANSVERSE CRACKING M 150.00 Ft Comments: